



VOLVO

SERVICE BULLETIN

ONLY FOR VOLVO DEALERS

RE:	FRONT END	PRODUCT	P
	P 120	GROUP	62
DATE	21.4.64	NO.	3

Replacement of lower wishbones, intermediate production.

Under particularly unfavourable conditions it has happened that fracturing has occurred on the lower wishbone immediately outside the hole for the wishbone bush. Only a very small number of cases have been reported and these would normally only be discovered when checking the front end components as recommended in our instruction books. Since, however, it may be difficult to determine the beginning of a fracture, we have decided to supply new wishbones free of charge which should preferably be fitted during normal front end service.

This successive replacement applies only to P 120 manufactured during the period August 1961 - March 1963 with the following chassis numbers:

4-door	85,000 - 130,000
2-door	1 - 25,220
Station Wagon	1 - 5,400

A simple way of identifying the above wishbones is that the inner ends are cut off square, whereas those which have been fitted since March 1963 are formed in an arc, see the figure overleaf. In this connection we would mention that the modification undertaken in March 1963 was not due to the reasons described above, but was carried out in order to improve the location of the wishbone bushes.

Claims should be submitted in the usual manner referring to this service bulletin. If considered suitable, a monthly group claim can be used. The following material is required and can be ordered from our Spare Parts Department.

<u>Description</u>	<u>Part Number</u>	<u>Quantity per vehicle</u>
Wishbone, lower, left	663661	1
Wishbone, lower, right	663662	1
Rubber bush	663675	4

as well as the necessary bolts, nuts and washers.