



VOLVO

SERVICE BULLETIN

ONLY FOR VOLVO DEALERS

RE:	STEERING ROD	PRODUCT	P
	P 120 Station Wagon	GROUP	64
DATE	11.11.1966	NO.	7

Replaces previous Service Bulletin, Product P, Group 64, No. 7 dated 28.10.1966.

Incorrectly fitted steering rods for the P 120 Station Wagon.

Unfortunately the steering rods for a number of the above-mentioned vehicles were fitted the wrong way round in production so that the outer end of the rods faces inwards.

The rods are marked with "L" (left-hand side) and "R" (right-hand side), see Workshop Bulletin, Product P, Group 64, No. 6, May 1965. The "L" marked rod should be fitted on the left-hand side with the "L" marked end nearest to the wheel. The same applies to the "R" marked rod, where the "R" marked end faces the right-hand wheel.

Vehicles with the chassis numbers listed below should be checked when the vehicles are in the workshop in connection with other repair work:

42000-43679	44646	44740
43681-44402	44647	44743
44404-44474	44649	44744
44476-44523	44651	44757
44525-44536	44653-44656	44761
44538-44545	44658-44663	44763
44547-44561	44665-44668	44764
44563-44604	44670	44767
44607-44613	44672	44769
44615-44621	44674	44775
44623	44677	44776
44625-44637	44680	44779
44639	44682	44782
44640	44689	44787
44641	44707-44711	44789
44643	44716	44790
44644	44739	44792-44863