



VOLVO

SERVICE BULLETIN

ONLY FOR VOLVO DEALERS

RE:	AUTOMATIC TRANSMISSION BW 35 1800 ES	PRODUK P GRUPP 44 NO. 2
DATE	April 3, 1973	

OIL COOLER HOSE, 1800 ES, 1973

The nipple of the right hand oil cooler hose, P/N 686001-9, can become situated so close to the stabilizer bar that there is very little clearance, or no clearance at all.

The fault can be corrected by fitting a piece of rubber in front of the radiator pin in the rubber grommet, which will force the radiator to the rear.

This remedy was introduced in the production, commencing with chassis number 5785.

Commencing with chassis number 6150, the right hand hose has been altered and has a nipple of the same kind as the left hand hose. The P/N is unchanged.

NOTE: The position numbers of the left hand and the right hand hose are confused in the Spare Parts Catalogue.