
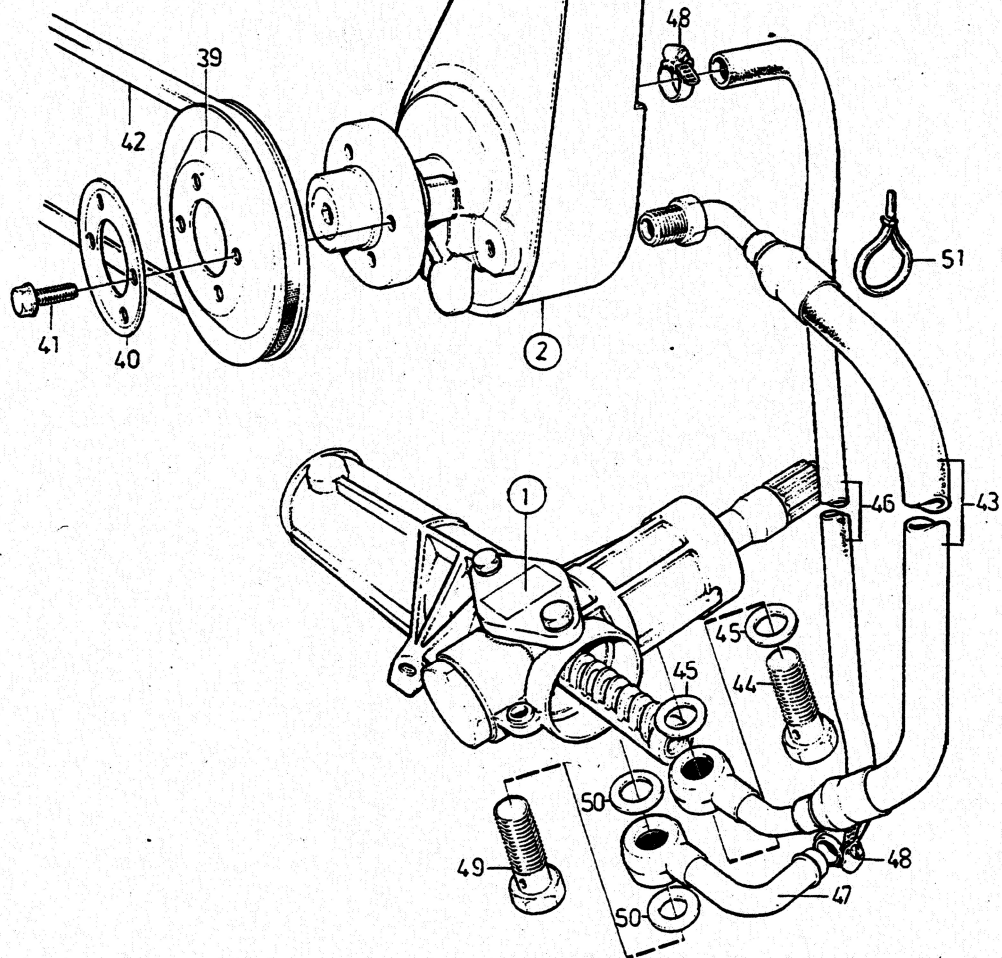


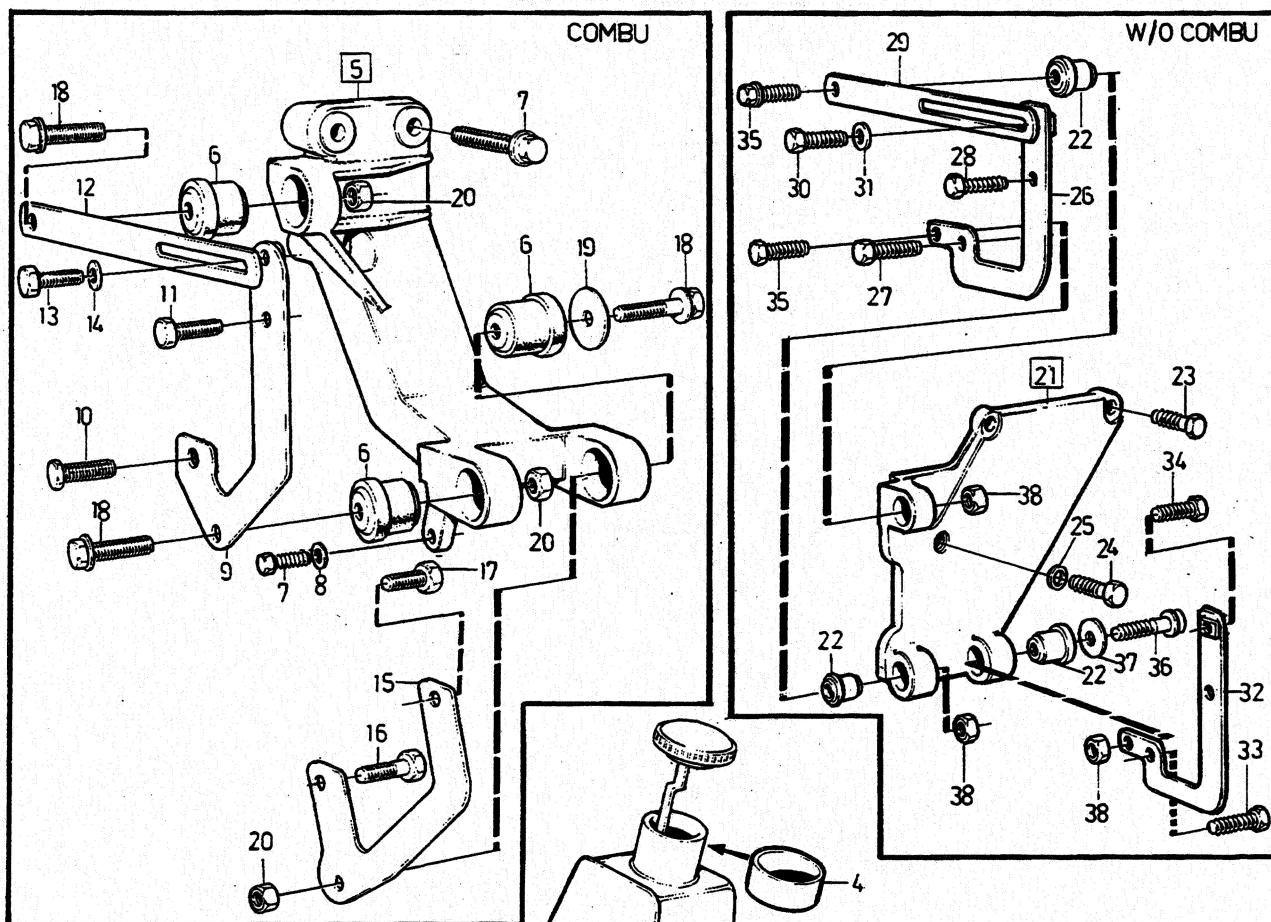

A B C D E							STEERING GEAR SERVO EQUIPMENT		STYRVÄXEL SERVOUTRUSTNING		Group Grupp
											64
											Page Sida
									DSL		735
Fig	Part No. Artikel nr	Quantity / Antal					P S	Description	Benämning	Notes Anmärkning	S R
		A	B	C	D	E					
1	(1359900)	1	-	-	-	-	SP	Steering gear	Styrväxel	1) CAM 240 4DRS CH -363964, 240 5DRS CH -831001, REPL 1 PCS 3516941-6.	5
	3516941-6	1	-	-	-	-		Steering gear	Styrväxel	1) CAM 240 4DRS CH 363965- 240 5DRS CH 831002-	5
		-	-	-	-	-		•SEE 64-747	•SEE 64-747		
2	1359116-9	1	-	-	-	-		Servo pump	Servopump		5
		-	-	-	-	-		•SEE 64-751	•SEE 64-751		
4	1329682-7	1	-	-	-	-		Collar	Krage		2
5	1328517-6	1	-	-	-	-		Bracket	Konsol	COMBU	4
6	463909-2	3	-	-	-	-		•Rubber bushing	•Gummibussning		5
7	948217-5	4	-	-	-	-		Flange screw	Flänsskruv		2
8	976944-9	1	-	-	-	-		Washer	Bricka	(960141)	2
9	1257468-7	1	-	-	-	-		Attaching arm, front	Fästarm, främre	COMBU	6
10	946329-0	1	-	-	-	-		Flange screw	Flänsskruv		2
11	946441-3	1	-	-	-	-		Flange screw	Flänsskruv		2
12	1257470-3	1	-	-	-	-		Tensioning arm	Spännarm	COMBU	5
13	946173-2	1	-	-	-	-		Flange screw	Flänsskruv		2
14	976944-9	1	-	-	-	-		Washer	Bricka	(960141)	2
15	1257469-5	1	-	-	-	-		Attaching arm, rear	Fästarm, bakre	COMBU	6
16	946441-3	1	-	-	-	-		Flange screw	Flänsskruv		2
17	970947-8	1	-	-	-	-		Screw	Skruv	(955317)	2
18	948217-5	3	-	-	-	-		Flange screw	Flänsskruv		2
19	948880-0	1	-	-	-	-		Washer	Bricka		2
20	945408-3	3	-	-	-	-		Flange nut	Flänsmutter		2
21	1257396-0	1	-	-	-	-		Bracket	Konsol	W/O COMBU	4
22	463909-2	3	-	-	-	-		•Rubber bushing	•Gummibussning		5
23	946472-8	2	-	-	-	-		Flange screw	Flänsskruv		2
24	946752-3	1	-	-	-	-		Flange screw	Flänsskruv		2
25	960148-5	1	-	-	-	-		Washer	Bricka		2
26	1257458-8	1	-	-	-	-		Attaching arm, front	Fästarm, främre	W/O COMBU	4
27	946329-0	1	-	-	-	-		Flange screw	Flänsskruv		2
28	946441-3	1	-	-	-	-		Flange screw	Flänsskruv		2
29	1328498-9	1	-	-	-	-		Tensioning arm	Spännarm	W/O COMBU	5
30	946173-2	1	-	-	-	-		Flange screw	Flänsskruv		2
31	976944-9	1	-	-	-	-		Washer	Bricka	(960144)	2
32	1257459-6	1	-	-	-	-		Attaching arm, rear	Fästarm, bakre	W/O COMBU	5
33	946472-8	1	-	-	-	-		Flange screw	Flänsskruv		2
34	946441-3	1	-	-	-	-		Flange screw	Flänsskruv		2
35	948217-5	2	-	-	-	-		Flange screw	Flänsskruv		2
36	965216-5	1	-	-	-	-		Flange screw	Flänsskruv		2
37	948880-0	1	-	-	-	-		Washer	Bricka		2
38	945408-3	3	-	-	-	-		Flange nut	Flänsmutter		2
39	1219961-8	1	-	-	-	-		Pulley	Remskiva		4
40	464541-2	1	-	-	-	-		Washer	Bricka	W/O COMBU	4
41	944926-5	4	-	-	-	-		Flange screw	Flänsskruv		2
42	976411-9	1	-	-	-	-		Drive belt servo pump-crankshaft	Drivrem servopump-vevaxel ...	(966905) W/O COMBU	1
	973544-0	1	-	-	-	-		V-belt servo pump-fan-crankshaft	Kilrem servopump-fläkt-vevaxel	(966923) COMBU	1
43	1229256-1	1	-	-	-	-		Pressure hose	Tryckslang	W/O COMBU	3
	1272885-3	1	-	-	-	-		Pressure hose	Tryckslang	COMBU	3
44	968179-2	1	-	-	-	-		Hollow screw	Hålskruv		2
45	18671-8	2	-	-	-	-		Gasket	Packning		2
46	1228399-0	1	-	-	-	-		Return hose	Returslang	LG 520 mm	2

1) Service plate marked 2. / Serviceskylten märkt 2.

A							STEERING GEAR SERVO EQUIPMENT		STYRVÄXEL SERVOUTRUSTNING		Group Grupp
B											64
C											Page Sida
D											737
E							DSL				
Fig	Part No. Artikel nr	Quantity / Antal					P S	Description	Benämning	Notes Anmärkning	S R
		A	B	C	D	E					
	1228399-0	1	-	-	-	-		Return hose	Returslang	W/O COMBU LG 670 mm COMBU	2
47	1206602-3	1	-	-	-	-		Nipple	Nippel		3
48	967919-2	2	-	-	-	-		Hose clamp	Slangklamma		2
49	974678-5	1	-	-	-	-		Hollow screw	Hålskruv	(941686)	2
50	11996-6	2	-	-	-	-		Gasket	Packning		1
51	948211-8	1	-	-	-	-		Strip clamp	Bandklamma		2