



VOLVO

SERVICE BULLETIN


ONLY FOR VOLVO DEALERS

RE:	AUTOMATIC TRANSMISSION BW 35	PRODUCT P GROUP 44 NO. 1
DATE	October 25, 1972	


Valve spindle for centrifugal governor

It has happened on a number of occasions that the valve spindle for the new centrifugal governor, see WB P - 44 - 26, has been too long. With unfavourable tolerances, the spindle can catch in the inside of the rear housing and disturb the function of the governor.

When fitting a new governor, or when checking an installed governor, check also the measurement according to the Figs. below. If the spindle is too long (B), grind it off to the correct length (A).

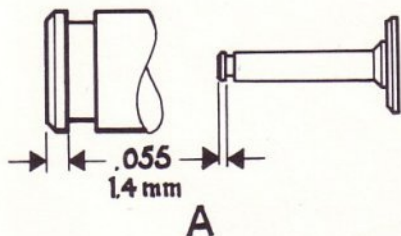

A. Correct spindle

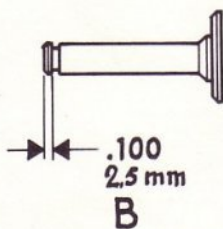

B. Incorrect spindle

VOLVO
200 205