


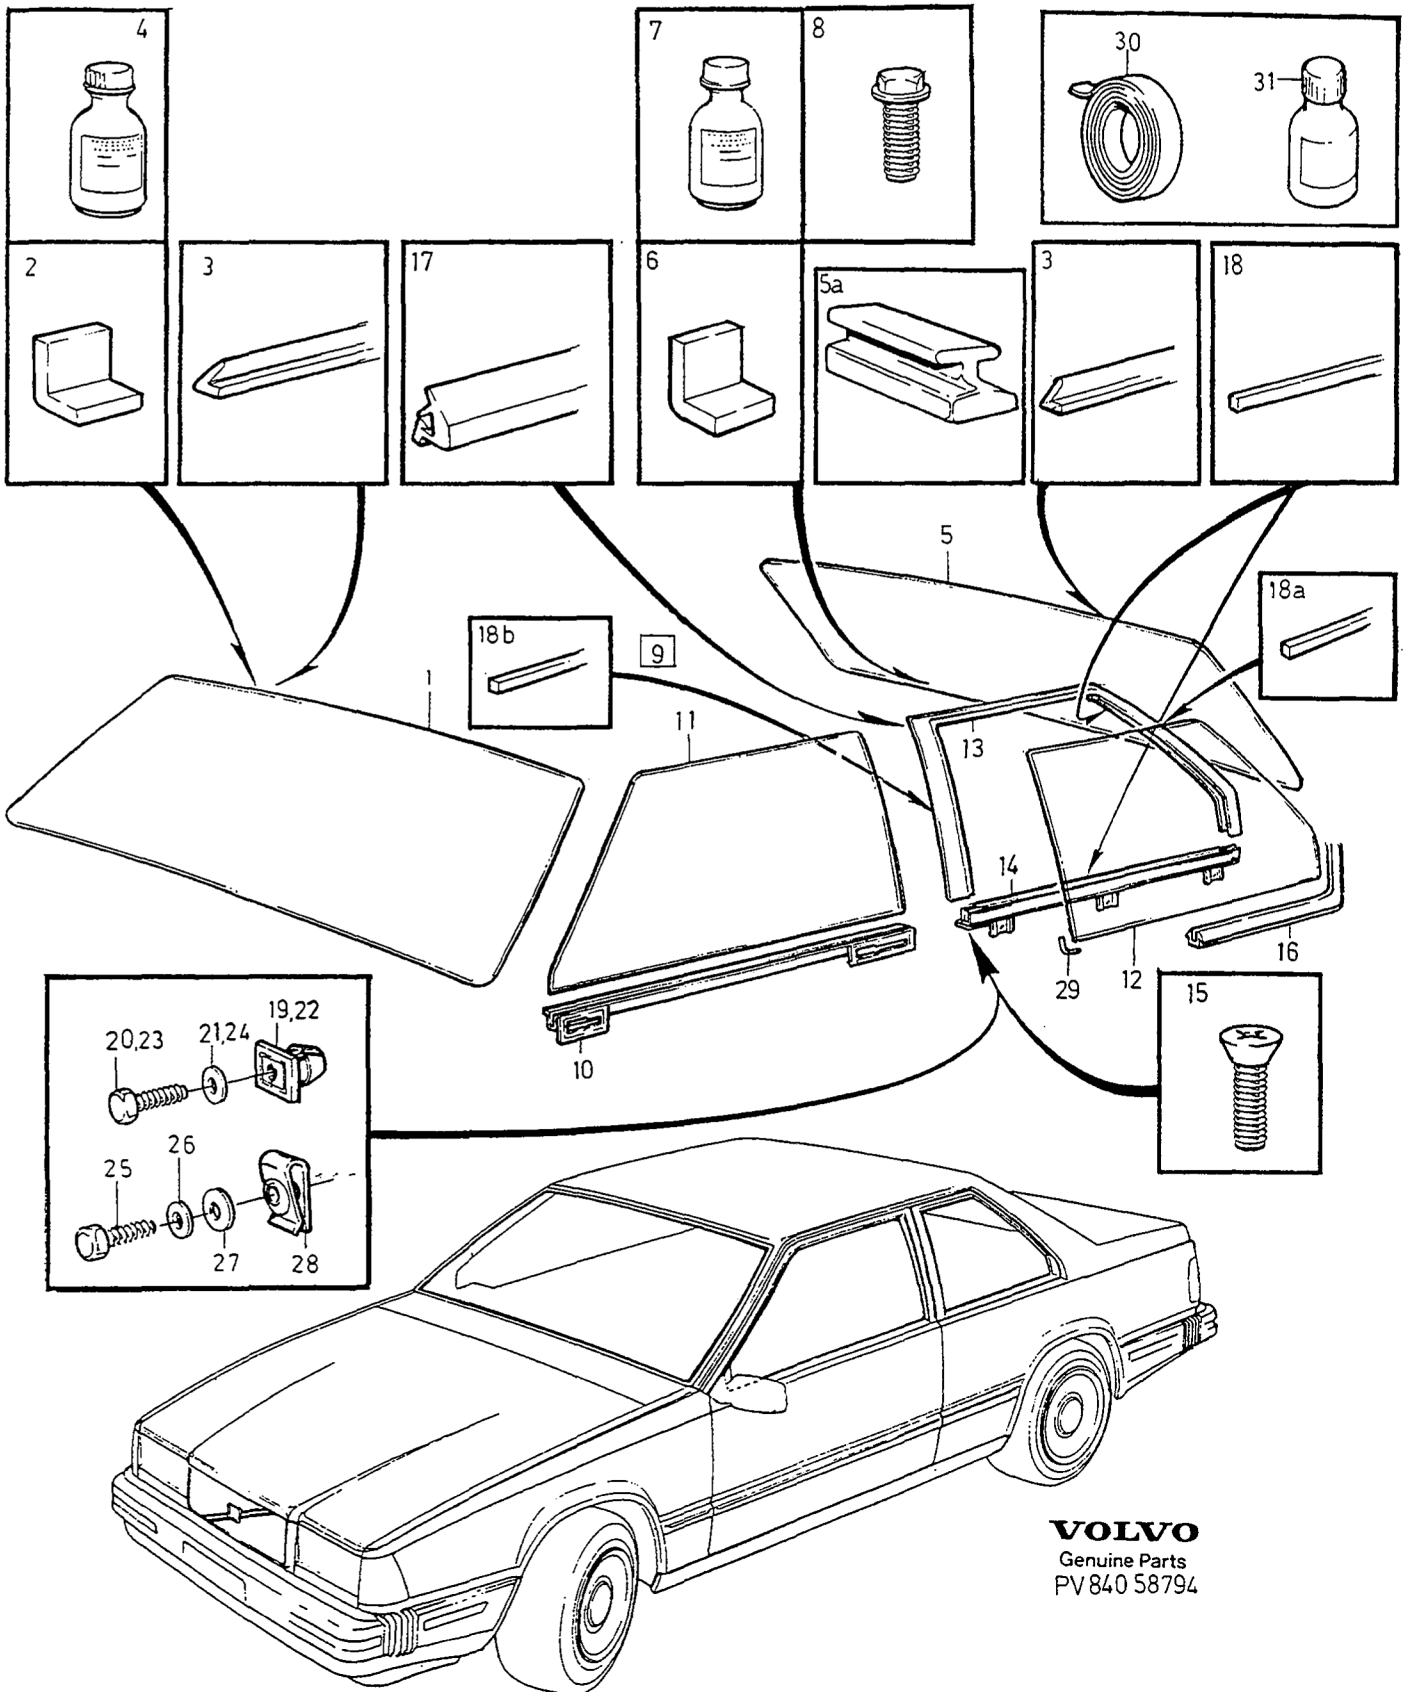

VOLVO
Genuine Parts
PV 840 58794

A							WINDSCREEN, REAR WINDOW AND DOOR VINDRUTA, BAKRUTA, SIDORUTOR		Group		
B							WINDOWS		Grupp		
C									84		
D									Page		
E									Sida		
									911		
Fig	Part No. Artikel nr	Quantity / Antal					P S	Description	Benämning	Notes Anmärkning	S R
		A	B	C	D	E					
1	1341301-8	1	-	-	-	-		Windscreen	Vindruta		2
2	1356431-5	4	-	-	-	-		Spacer disc	Distansskiva		2
3	1376106-9	X	-	-	-	-		Protecting moulding	Skyddslist		2
4	1161287-6	1	-	-	-	-		Adhesive kit	Limsats		4
5	1341303-4	1	-	-	-	-		Rear window	Bakruta	1)	3
	1356476-0	1	-	-	-	-		Rear window	Bakruta	2)	3
5a	1312889-7	1	-	-	-	-		•Rail	•Skena		2
6	1356431-5	4	-	-	-	-		Spacer disc	Distansskiva		2
7	1161287-6	1	-	-	-	-		Adhesive kit	Limsats		4
8	967552-1	1	-	-	-	-		Flange screw	Flänsskruv	(946051)	1
								Earth cable	Jordledning		
9	1341483-4	1	-	-	-	-		Glass, l.h.	Glas, v		3
	1341484-2	1	-	-	-	-		Glass, r.h.	Glas, h		3
10		1	-	-	-	-	NS	•Lift rail	•Hisskena		
11		1	-	-	-	-	NS	•Glass	•Glas		
12	1341307-5	1	-	-	-	-		Side window glass, l.h.	Sidofönsterglas, v		3
	1341308-3	1	-	-	-	-		Side window glass, r.h.	Sidofönsterglas, h		3
13	3510775-4	1	-	-	-	-		Frame, l.h.	Ram, v	(1341254) CH-4289	3
	3510775-4	1	-	-	-	-		Frame, l.h.	Ram, v	CH 4290-	3
	3510776-2	1	-	-	-	-		Frame, r.h.	Ram, h	(1341255) CH-4289	3
	3510776-2	1	-	-	-	-		Frame, r.h.	Ram, h	CH 4290-	3
14	1341817-3	1	-	-	-	-		Frame, l.h.	Ram, v		3
	1341818-1	1	-	-	-	-		Frame, r.h.	Ram, h		3
15	969737-6	4	-	-	-	-		Screw	Skruv	(956203)	2
16	1356183-2	1	-	-	-	-		Sealing strip, l.h.	Tätningslist, v		3
	1356184-0	1	-	-	-	-		Sealing strip, r.h.	Tätningslist, h		3
17	3510337-3	1	-	-	-	-		Sealing strip, l.h.	Tätningslist, v		3
								Frame	Ram		
	3510338-1	1	-	-	-	-		Sealing strip, r.h.	Tätningslist, h		3
								Frame	Ram		
18	3510472-8	X	-	-	-	-		Seal upper	Tätning övre	LG 2x1050 mm	3
	3510472-8	X	-	-	-	-		Seal upper	Tätning övre	LG 2x400 mm	3
	3510472-8	X	-	-	-	-		Seal lower	Tätning nedre	LG 2x770 mm	3
18a	3510466-0	X	-	-	-	-		Seal	Tätning	LG 2x1500 mm	3
18b	3510476-9	X	-	-	-	-		Seal	Tätning	LG 2x400 mm	3
19	1356208-7	22	-	-	-	-		Retainer	Hållare	CH-2240	2
20	955130-0	22	-	-	-	-		Screw	Skruv	CH-2240	2
21	960138-6	22	-	-	-	-		Washer	Bricka	(1356202) CH-2240	2
22	1356208-7	6	-	-	-	-		Retainer	Hållare	CH 2241-	2
23	955130-0	6	-	-	-	-		Screw	Skruv	CH 2241-	2
24	960138-6	6	-	-	-	-		Washer	Bricka	CH 2241-	2
25	955130-0	16	-	-	-	-		Screw	Skruv	CH 2241-	2
26	960138-6	16	-	-	-	-		Washer	Bricka	CH 2241-	2
27	3510596-4	16	-	-	-	-		Washer	Bricka	CH 2241-	2
28	948571-5	16	-	-	-	-		Spring nut	Fjädermutter	CH 2241-	2
29	3406333-9	10	-	-	-	-		Seal	Tätning		6
30	273923-3	1	-	-	-	-		Adhesive kit	Limsats		2
		1	-	-	-	-	KN	•Butyl tape	•Butyltejp		
		2	-	-	-	-	KN	•Spacer	•Distansstycke		
		2	-	-	-	-	KN	•Spacer	•Distansstycke		
31	1161156-3	1	-	-	-	-		Glass primer	Glasprimer		6
	1161386-6	1	-	-	-	-		Paintprimer	Lackprimer		4

1) Cars without extra brake light. / Bilar utan extra bromsljus.

2) Cars with extra brake light. / Bilar med extra bromsljus.