


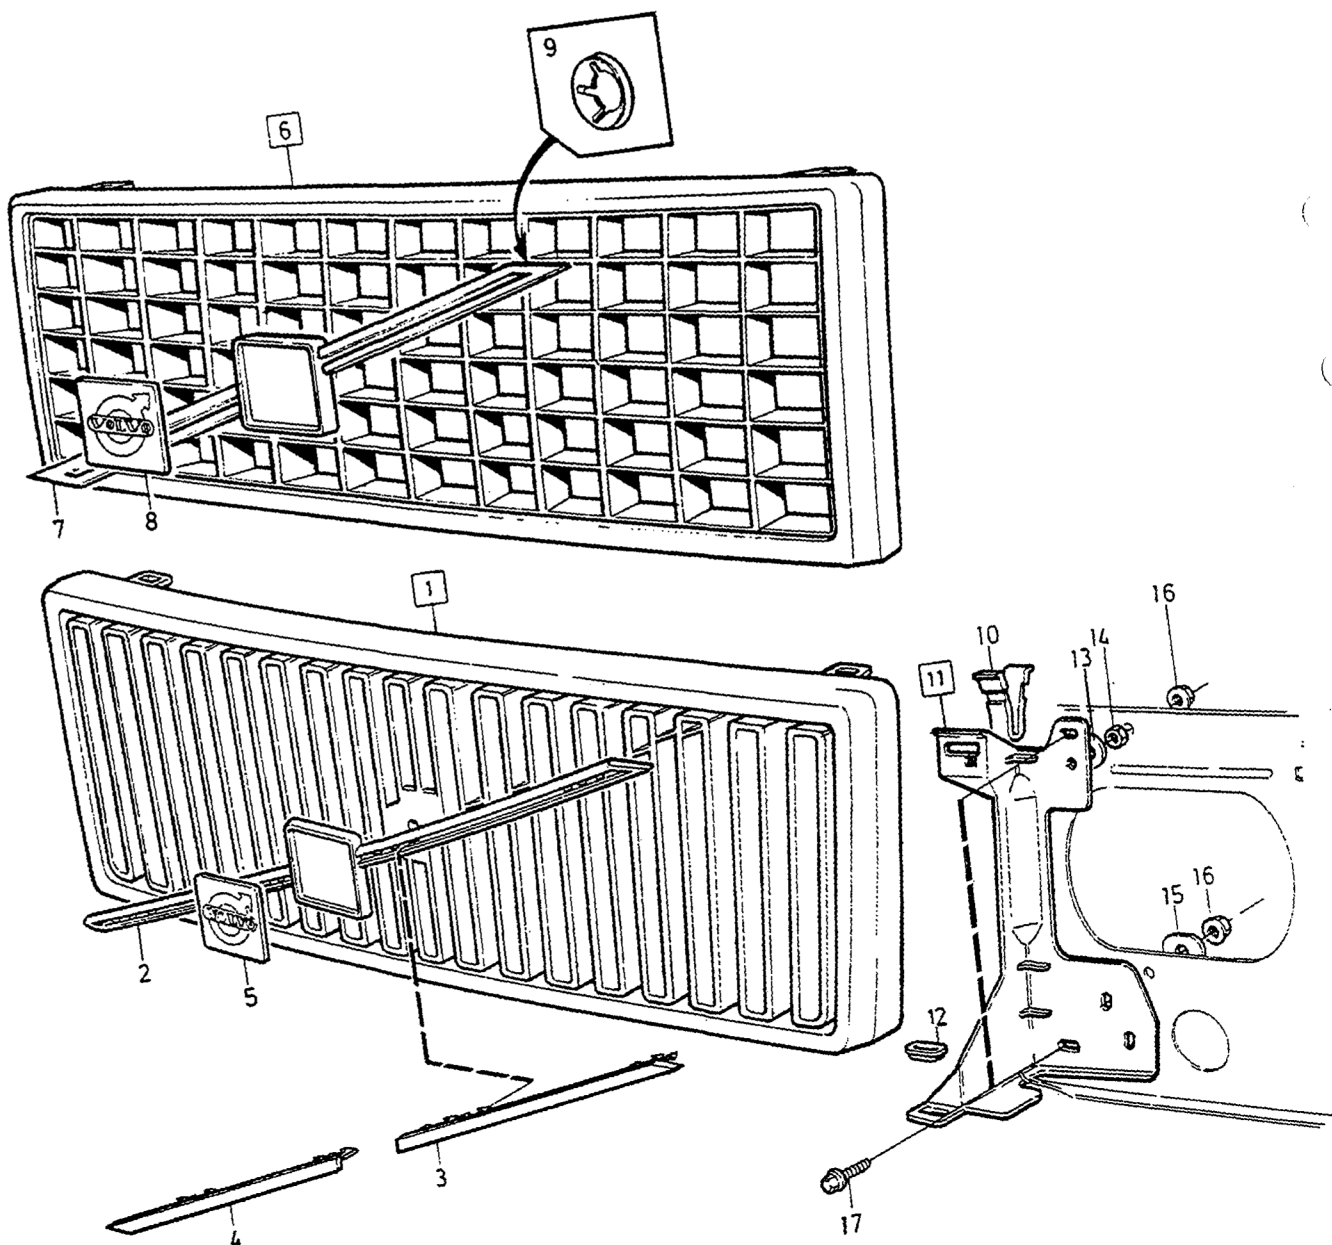

© **VOLVO**
Genuine Parts
PV820 42860

A						KYLARGALLER		KÜHLERGITTER		Grupp Gruppe	
B										82	
C										Sida Seite	
D										1295	
E											
Pos	Artikel nr Artikelnr.	Antal / Anzahl					P S	Benämning	Bezeichnung	Anmärkning Anmerkung	S R
		A	B	C	D	E					
1	1358896-7	1	-	-	-	-		Kylargaller	Kühlergrill	1)	2
	1358898-3	1	-	-	-	-		Kylargaller	Kühlergrill	2)	2
	1369023-5	1	-	-	-	-		Kylargaller	Kühlergrill	3) (1358900) -1985	2
2	1268252-2	1	-	-	-	-		• Prydnadslist	• Zierleiste		2
3	1268930-3	1	-	-	-	-		• Fäste, v	• Halterung, l		2
4	1268931-1	1	-	-	-	-		• Fäste, h	• Halterung, r		2
5	1325751-4	1	-	-	-	-		• Emblem	• Emblem		2
6	1369023-5	1	-	-	-	-		Kylargaller	Kühlergrill	3) 1986-	2
7	1342672-1	1	-	-	-	-		• Prydnadslist	• Zierleiste		2
8	1342673-9	1	-	-	-	-		• Emblem	• Emblem		2
9	968039-8	4	-	-	-	-		• Hållare	• Halter		2
10	1268673-9	2	-	-	-	-		Låskil	Schliesskeil		2
11	(1358818)	1	-	-	-	-	SP	Konsol, v	Konsole, l	-1986. REPL 1 PCS 1358942-9, 2 PCS 192287-1, 2 PCS 955781-0.	2
	1358942-9	1	-	-	-	-		Konsol, v	Konsole, l		2
	(1358819)	1	-	-	-	-	SP	Konsol, h	Konsole, r	-1986. REPL 1 PCS 1358943-7, 2 PCS 192287-1, 2 PCS 955781-0.	2
	1358943-7	1	-	-	-	-		Konsol, h	Konsole, r	1987-	2
12	1358168-1	1	-	-	-	-		• Bussning	• Buchse		2
13	192287-1	2	-	-	-	-		Bricka	Scheibe	-1986	2
14	955781-0	2	-	-	-	-		Mutter	Mutter	-1986	2
15	960139-4	2	-	-	-	-		Bricka	Scheibe	-1986	2
16	945407-5	4	-	-	-	-		Flänsmutter	Bundmutter	-1986	2
	949278-6	4	-	-	-	-		Flänslåsmutter	Flanschverschlussmutter	1987-	2
17	(968287)	4	-	-	-	-	SP	Skruv	Schraube	REPL 1 PCS 947542-7, 1 PCS 960139-4. 1987-	2

- 1) Förokromad galler med förokromad ram. / Verchromtes Gitter mit verchromtem Rahmen.
 2) Svart galler med förokromad ram. / Schwarzes Gitter mit verchromtem Rahmen.
 3) Svart galler med svart ram. / Schwarzes Gitter mit schwarzem Rahmen.