


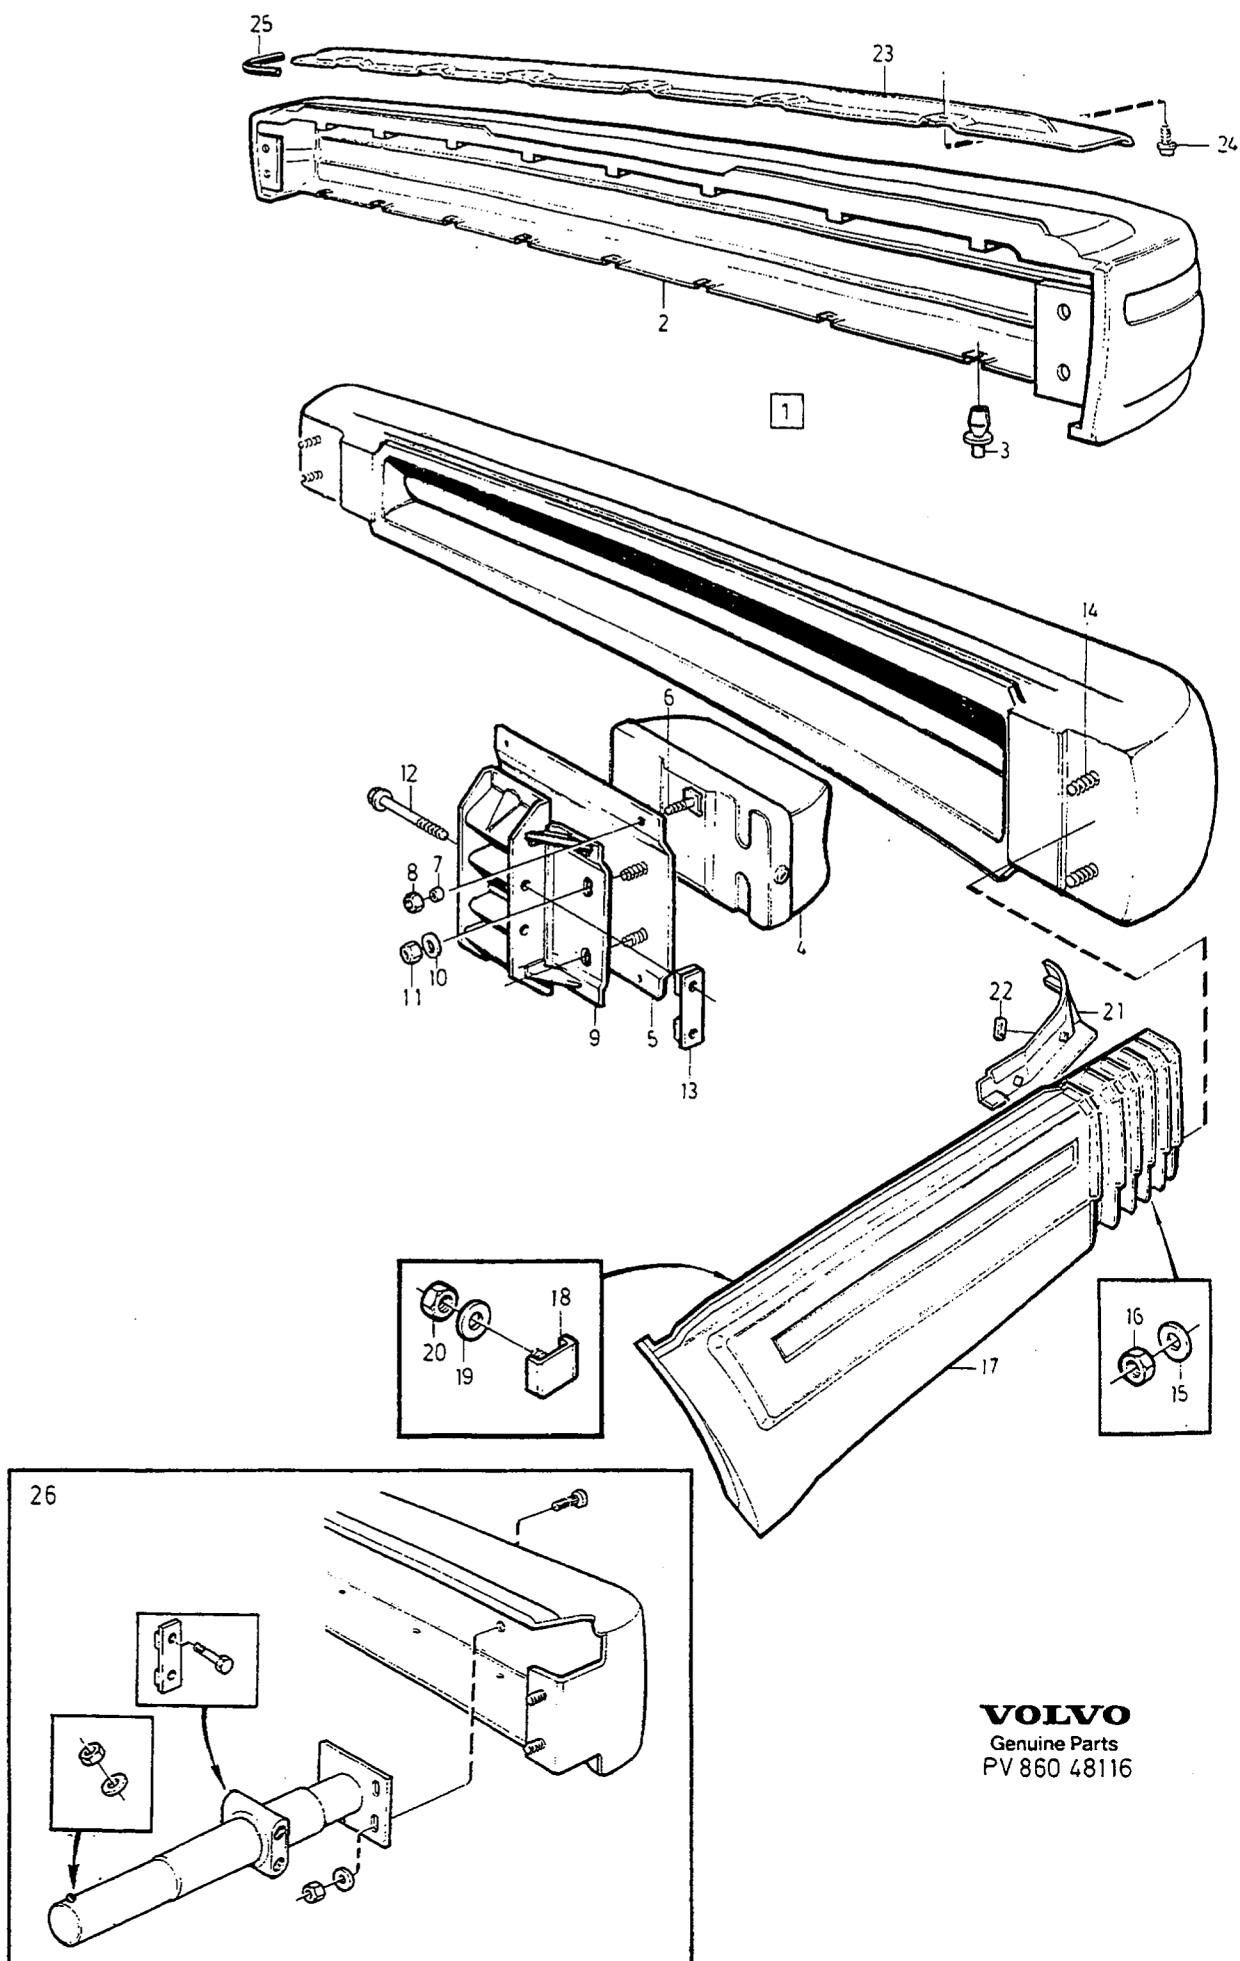

VOLVO
Genuine Parts
PV 860 48116

A

B

C

D

E

BAKRE STÖTFÄNGARE. FORMBLÅST

ABSORPTIONS STÖTFÄNGARE.

HINTERER STOSSFÄNGER

FORMGESPRITZER

ABSORPTIONSSTOSSFÄNGER

ALTER 1987-

Grupp

Gruppe

86

Sida

Seite

1529

Pos	Artikel nr Artikelnr.	Antal / Anzahl					P S	Benämning	Bezeichnung	Anmärkning Anmerkung	S R
		A	B	C	D	E					
1		1	-	-	-	-	NS	Stötfångare	Stossfänger		
2	1369583-8	1	-	-	-	-		Ytterhölje	Stossfängerhaut		2
3	1369586-1	15	-	-	-	-		Clips	Klemme		2
4		2	-	-	-	-	NS	Dämpare	Dämpfer		
5	1369589-5	2	-	-	-	-		Fästplatta	Befestigungsplatte		2
6	1369587-9	8	-	-	-	-		Fästplåt	Befestigungsblech		2
7	1369595-2	8	-	-	-	-		Distanshylsa	Abstandhülse		2
8	945407-5	8	-	-	-	-		Flänsmutter	Bundmutter		2
9	1369591-1	2	-	-	-	-		Fäste, bakre	Halterung, h		2
10	960143-6	4	-	-	-	-		Bricka	Scheibe		2
11	971071-6	4	-	-	-	-		Mutter	Mutter	(955783)	2
12	947790-2	4	-	-	-	-		Flänsskruv	Flanschschraube		2
13	1321633-8	2	-	-	-	-		Mutterplatta	Gewindeplatte		3
14	1369715-6	4	-	-	-	-		Expanderskruv	Expanderschraube		2
15	949817-1	4	-	-	-	-		Bricka	Scheibe		2
16	955781-0	4	-	-	-	-		Mutter	Mutter		2
17	1392922-9	1	-	-	-	-		Ändstycke, v svart	Endstück, l svart	(1325819)	2
	1392923-7	1	-	-	-	-		Ändstycke, h svart	Endstück, r svart	(1325821)	2
18	3518077-7	6	-	-	-	-		Fästplåt	Befestigungsblech	(1320383)	2
19	960139-4	6	-	-	-	-		Bricka	Scheibe		2
20	955781-0	6	-	-	-	-		Mutter	Mutter		2
21	1325836-3	1	-	-	-	-		Tätning, v	Dichtung, l		3
	1325837-1	1	-	-	-	-		Tätning, h	Dichtung, r		3
22	1325859-5	2	-	-	-	-		Clips	Klemme		2
23	1358052-7	1	-	-	-	-		Täcklist	Abdeckleiste	5DRS	2
24	969473-8	6	-	-	-	-		Sextandhålskruv	Sechszahn-hohlschraube	(946451)	2
25	1277210-9	X	-	-	-	-		Butyltejp	Butyl-kleber	2x85mm	2
26		-	-	-	-	-		Stötfångare	Stossfänger	1) SEE 86-1527	