
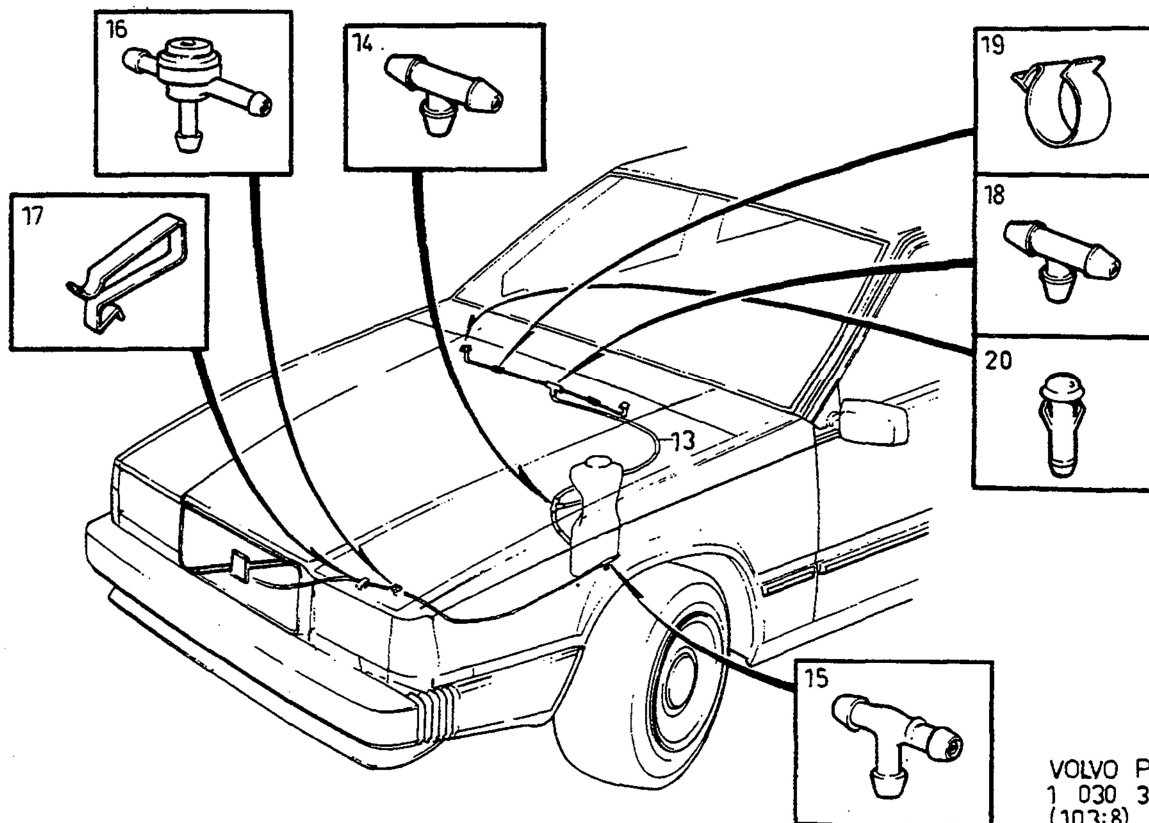


A		3,2l EXC (USA),(CDN)					VINDRUTESPOLARE		SCHEIBENWASCHANLAGE		Grupp	
B		2,0l (USA),(CDN)									36	
C											Sida	
D											Seite	
E									CH 49054-		513	
Pos	Artikelnummer Artikelnr.	Antal / Anzahl					P S	Benämning	Bezeichnung	Anmärkning Anmerkung	S R	
		A	B	C	D	E						
1		1	1	-	-	-	NS	Vindrutespolare	Frontscheibenspüler			
2	1342543-4	1	-	-	-	-		• Vattenbehållare	• Wasserbehälter	3,2l	3	
	1342540-0	-	1	-	-	-		• Vattenbehållare	• Wasserbehälter	2,0l	3	
☆ 3	1392854-4	1	1	-	-	-		• Manschett	• Manschette		3	
☆ 4	3538565-7	1	1	-	-	-		• Filter	• Filter	(1325678)	2	
☆ 5	3534305-2	1	1	-	-	-		• Tätning	• Dichtung	(1342537)	3	
☆ 6	9171057-4	1	1	-	-	-		• Lock	• Deckel		3	
☆ 7	9447467-3	2	1	-	-	-		• Tätning	• Dichtung	(1369175)(1342544)	3	
8	1258016-3	1	1	-	-	-		• Pump	• Pumpe		2	
9	1342538-4	1	1	-	-	-		• Påfyllningsrör	• Fullrohr		3	
10	1259825-6	1	1	-	-	-		• Muff	• Muffe		3	
11	3518883-8	1	1	-	-	-		• Lock	• Deckel	(1358013)	3	
12	(1392866)	1	1	-	-	-	SP	• Nivåvarnare	• Niveauwarner	REPL 1PCS 3526960-4, 1PCS 1307049-5, 1PCS 1323247-5, 1PCS 949210-9.	6	
☆ 13	3526960-4	1	1	-	-	-		• Nivåvarnare	• Niveauwarner		3	
14	1307049-5	1	1	-	-	-		• Stiftisolator	• Rundstecker		2	
15	1323247-5	1	1	-	-	-		• Elledning	• Elleitung		2	
☆ 16	973150-6	1	1	-	-	-		• Ledningssko	• Kabelschuh	(949201)(949210)	1	
17	949931-0	X	X	-	-	-		• Gummislang metervara	• Gummischlauch Meterware ..	4,0x2,0mm	2	
	943722-9	X	X	-	-	-		• Gummislang metervara	• Gummischlauch Meterware ..	2,5x1,25mm	2	
☆	976735-1	X	-	-	-	-		• Slang metervara	• Schlauch Meterware	5,2x2,5 (1336649)	2	
18	1392074-9	1	1	-	-	-		• Tryckventil	• Druckventil	(1342555)	2	
19	191404-3	3	3	-	-	-		• Klamma	• Klemme		2	
☆ 20	9151208-7	1	1	-	-	-		• Avluftningsventil	• Entlüftungsventil	(1342553)	2	
☆ 21	9151315-0	1	-	-	-	-		• T-rör	• T-stück		3	
22	1342554-1	1	-	-	-	-		• Tryckventil	• Druckventil		2	
☆ 23	1382494-1	2	2	-	-	-		• Spolarmunstycke	• Spulduse	(1312886)(1255383)	2	
☆	1382494-1	2	2	-	-	-		• Spolarmunstycke	• Spulduse	1) (1325676)	2	
24	1369348-6	1	1	-	-	-		• Konsol	• Konsole		3	
☆ 25	972258-8	2	2	-	-	-		• Sextandhålskruv	• Sechszahn-hohlschraube	(969473)(955137)	2	

1) Service-alternativ. / Service-Alternative.

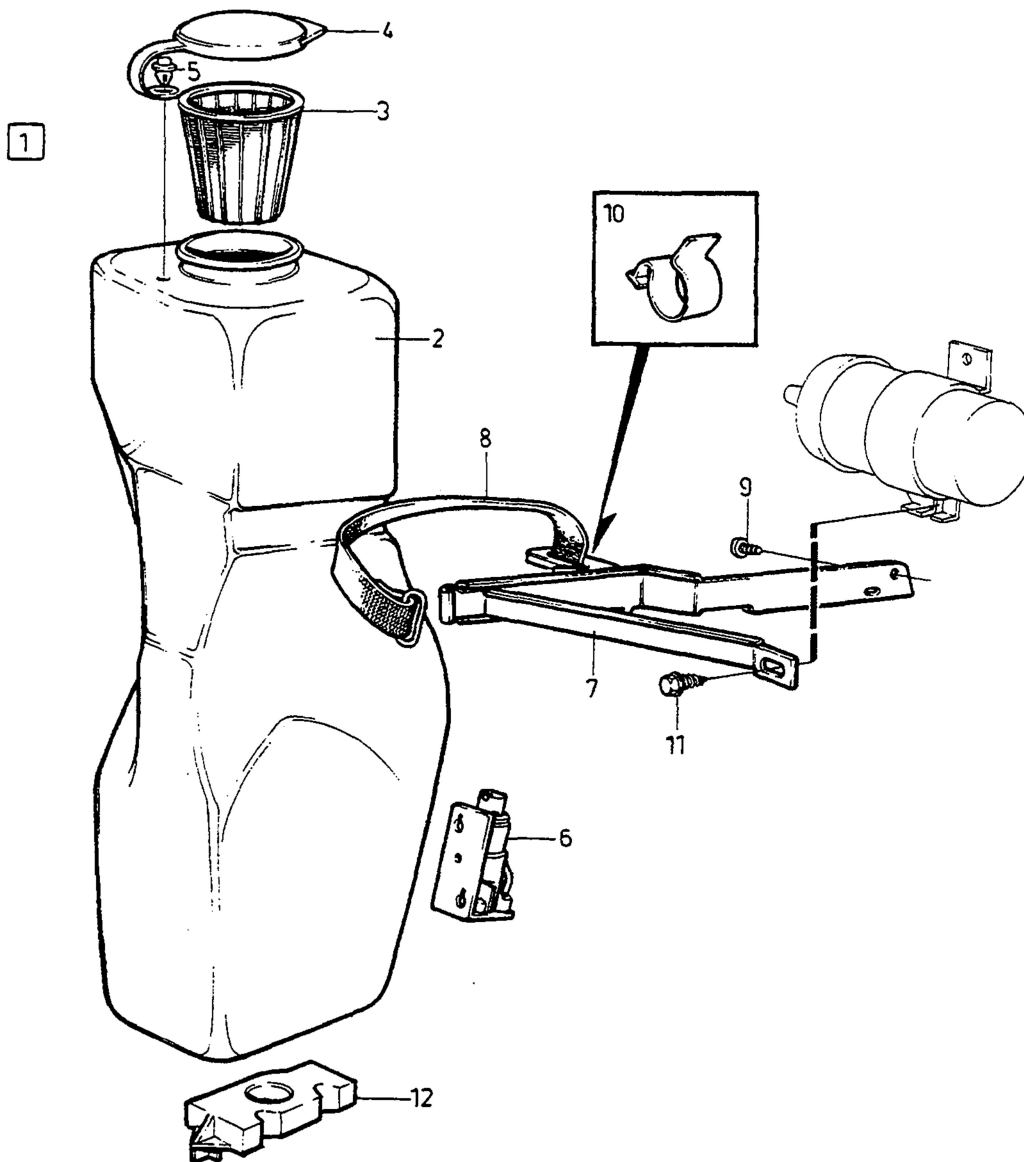

VOLVO PARTS
1 030 36899
(103:8)

A							VINDRUTESPOLARE		SCHEIBENWASCHANLAGE		Grupp Gruppe
B											36
C											Sida Seite
D									B19E TURBO		515
E											
Pos	Artikelnummer Artikelnr.	Antal / Anzahl					P S	Benämning	Bezeichnung	Anmärkning Anmerkung	S R
		A	B	C	D	E					
1		-	-	-	-	-		Vindrutespolare	Frontscheibenspuler		
2	1304149-6	1	-	-	-	-		• Vattenbehållare	• Wasserbehälter		2
☆ 3	3538565-7	1	-	-	-	-		• Filter	• Filter	(1325678)	2
4	1213943-2	1	-	-	-	-		• Lock	• Deckel		3
5		1	-	-	-	-	NS	• Nit	• Niet		
6	1304783-2	1	-	-	-	-		• Pump	• Pumpe		2
7	1342806-5	1	-	-	-	-		• Konsol	• Konsole		3
8	1325023	1	-	-	-	-	NS	• Band	• Band		
☆ 9	969278-1	2	-	-	-	-		• Sextandhålskruv	• Sechszahn-hohlschraube	(955138)	2
10	191404-3	1	-	-	-	-		• Klamma	• Klemme		2
11	965175-3	1	-	-	-	-		• Flänsskruv	• Flanschschraube		2
12	1342556	1	-	-	-	-	OP	• Stöd	• Stütze		3
13	949931-0	X	-	-	-	-		• Gummislang metervara	• Gummischlauch Meterware ..		2
14	3282469-0	1	-	-	-	-		• T-nippel	• T-nippel		6
☆ 15	9151315-0	1	-	-	-	-		• T-rör	• T-stück		3
16	1342554-1	1	-	-	-	-		• Tryckventil	• Druckventil		2
17	1323155-0	2	-	-	-	-		• Clips	• Klemme		2
18	1392074-9	1	-	-	-	-		• Tryckventil	• Druckventil	(1342555)	2
19	191404-3	3	-	-	-	-		• Klamma	• Klemme		2
☆ 20	1382494-1	2	-	-	-	-		• Spolarmunstycke	• Spulduse	(1312886)(1255383)	2
☆	1382494-1	2	-	-	-	-		Spolarmunstycke	Spulduse	1) (1325676)	2

1) Service-alternativ. / Service-Alternative.