

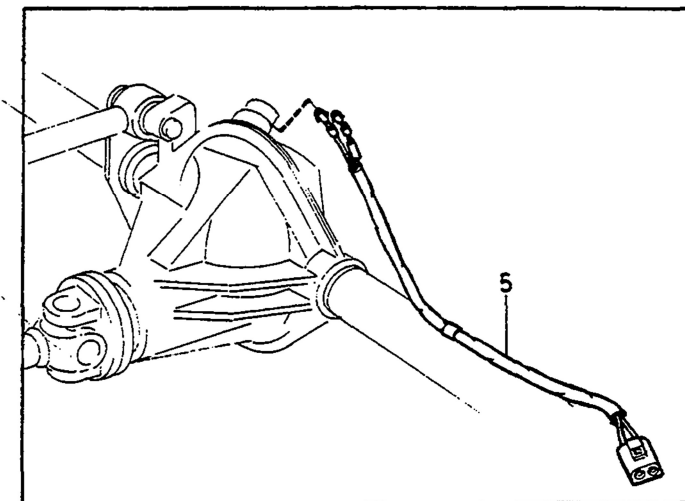
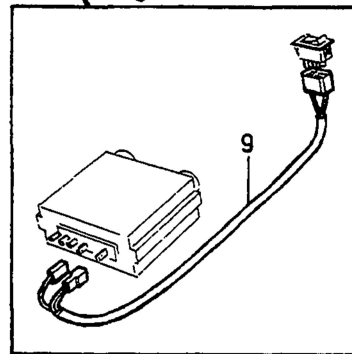
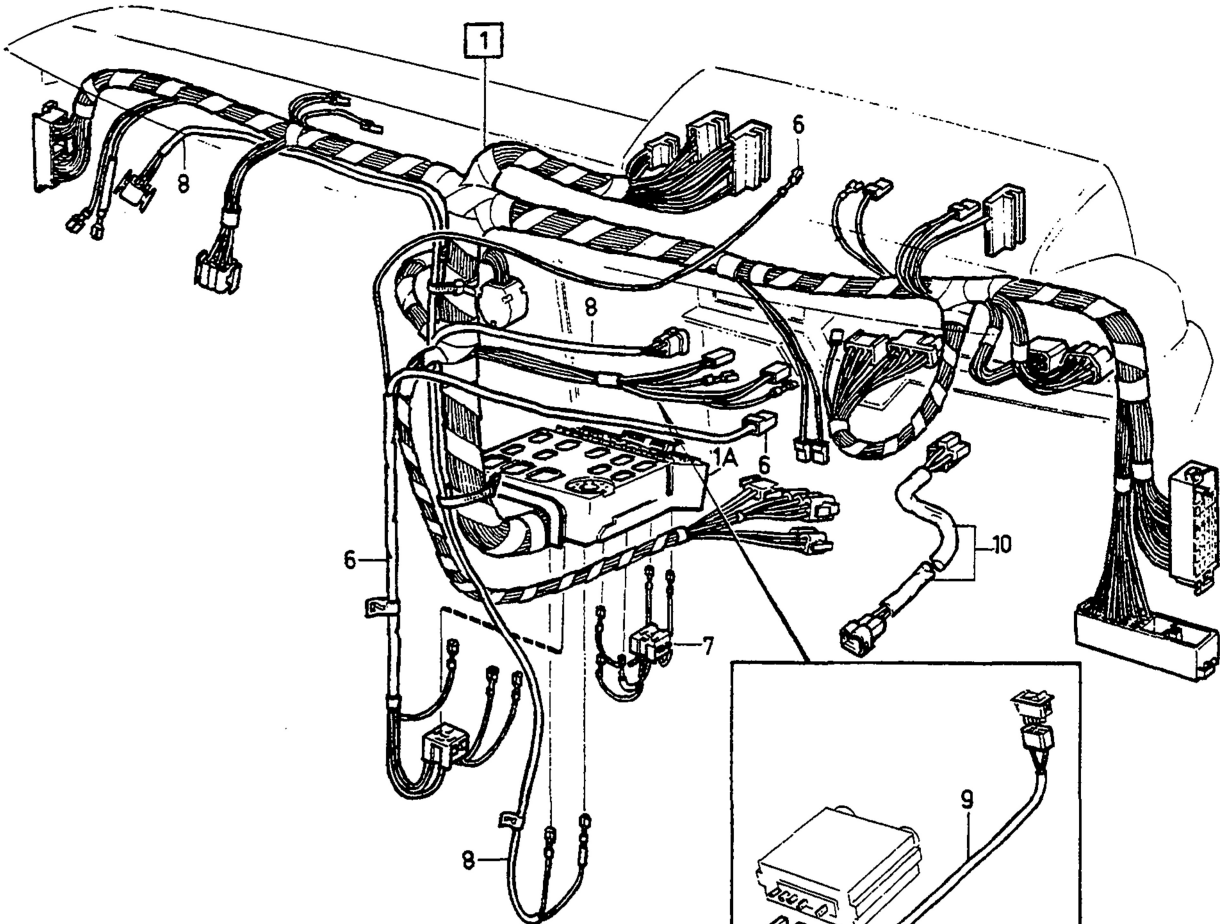
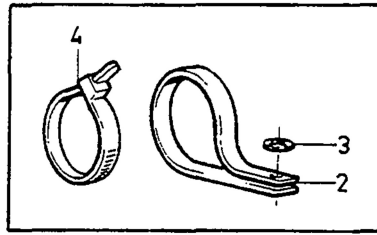
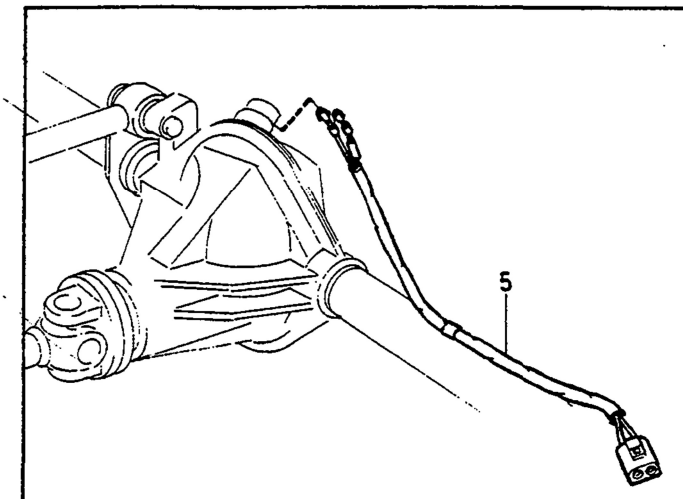
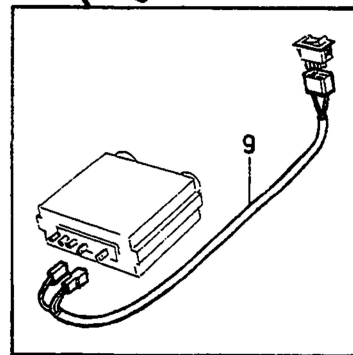


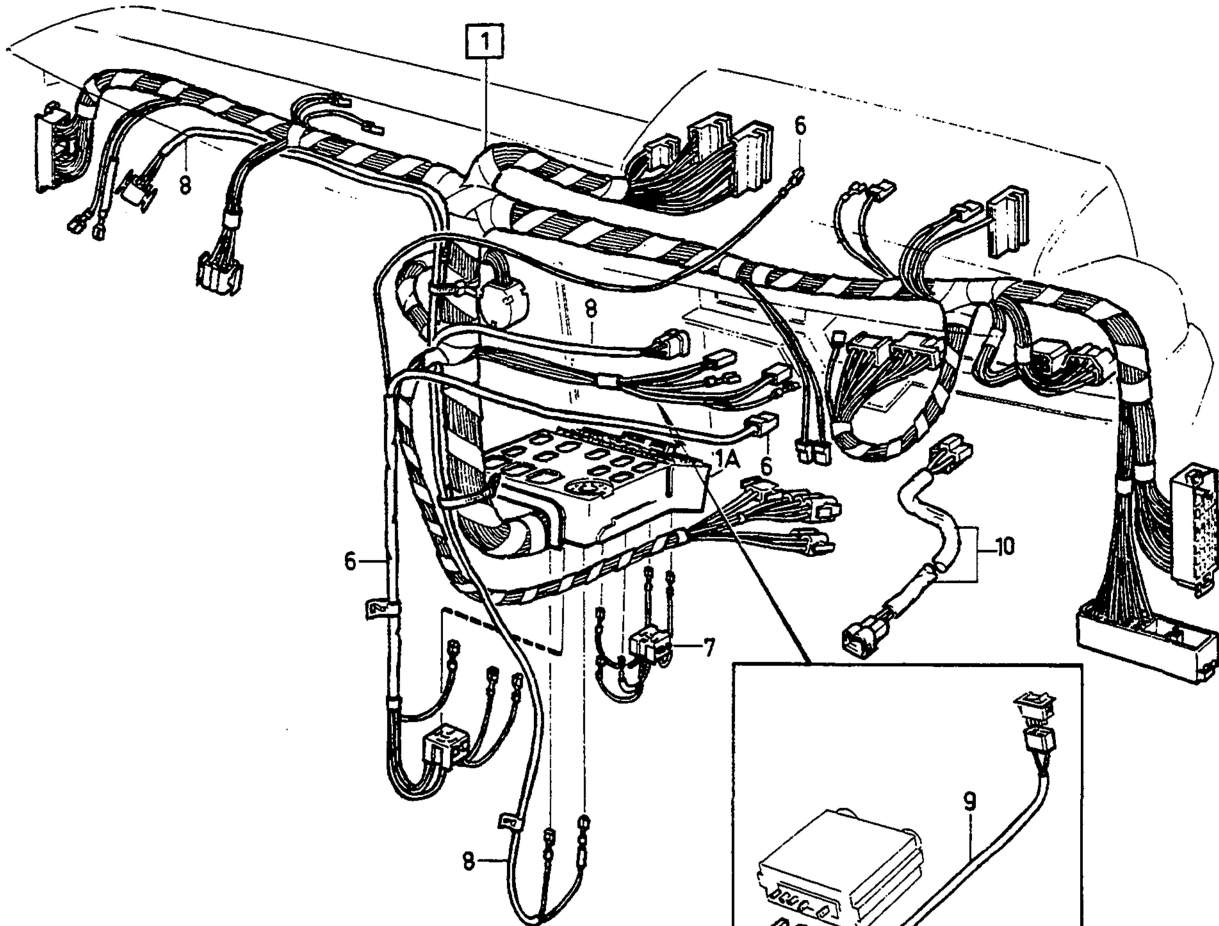

VOLVO PARTS
1 030 33467
(104:3)

A		B28A					LEDNINGSMATTA INSTRUMENTBRÄDA		KABELBAUM, KABELKANAL ARMATURENBRETT		Grupp Gruppe	
B		B28E									37	
C		B28F									Sida Seite	
D		B23ET									537	
E		D24T					-1983					
Pos	Artikelnummer Artikelnr.	Antal / Anzahl					P S	Benämning	Bezeichnung	Anmärkning Anmerkung	S R	
		A	B	C	D	E						
1	1323306-9	1	-	-	-	-		Ledningsmatta	Kabelbaum	L.H.D CH-18644 (1323610)	6	
	1324642-6	1	-	-	-	-		Instrumentbräda	Armaturenbrett	L.H.D CH 18645-	5	
	1258077-5	-	1	-	-	-		Ledningsmatta	Kabelbaum	-1982 L.H.D (1307872)	6	
	1323306-9	-	1	-	-	-		Instrumentbräda	Armaturenbrett	L.H.D EXC (S) CH 3800-18644 (1323610)	6	
	1324642-6	-	1	-	-	-		Ledningsmatta	Kabelbaum	L.H.D EXC (S) CH 18645-	5	
	1323926-4	-	1	-	-	-		Instrumentbräda	Armaturenbrett	(S) CH 3800-18413	6	
	1324721-8	-	1	-	-	-		Ledningsmatta	Kabelbaum	(S) CH 18413-	5	
	1258078-3	1	1	-	-	-		Instrumentbräda	Armaturenbrett	-1982 R.H.D (1307874)	6	
	1323307-7	1	1	1	-	-		Ledningsmatta	Kabelbaum	1983- R.H.D CH 3800-18648	6	
	1324645-9	1	1	-	-	-		Instrumentbräda	Armaturenbrett	R.H.D CH 18649-	5	
	1258057-7	1	1	1	-	-		Ledningsmatta	Kabelbaum	(USA) (1307870)	6	
	1324286-2	-	-	1	-	-		Instrumentbräda	Armaturenbrett	(J) (1308748)	5	
	1323927-2	-	-	-	1	-		Ledningsmatta	Kabelbaum	(S)	5	
	1323605-4	-	-	-	1	-		Instrumentbräda	Armaturenbrett	L.H.D EXC (S)	5	
	1323606-2	-	-	-	1	-		Ledningsmatta	Kabelbaum	R.H.D	5	
	1307020-6	-	-	-	-	1		Instrumentbräda	Armaturenbrett	-1982 L.H.D (1307877)	6	
	1323310-1	-	-	-	-	1		Ledningsmatta	Kabelbaum	1983- L.H.D EXC (S) (1323614)	6	
	1323928-0	-	-	-	-	1		Instrumentbräda	Armaturenbrett	1983- (S) (1323949)	6	
	1307018-0	-	-	-	-	1		Ledningsmatta	Kabelbaum	R.H.D	5	
	1307019-8	-	-	-	-	1		Instrumentpanel	Instrumententafel	(USA)(CDN)	5	
1a		1	1	1	1	1		Instrumentbräda	Armaturenbrett			
2	3523130-7	X	X	X	X	X		• Elcentral	• Elektrozentrale	SEE 37 • 565 LG 206mm (1308749)	2	
								Bandklamma	Bandklammer			
3	191695-6	X	X	X	X	X				(965744)	2	
4	948211-8	X	X	X	X	X				LG 75mm	2	
☆ 5	3515928-4	1	1	1	1	1		Ledningsmatta	Kabelbaum	(3515242)(1324069)	5	
								Givare	Geber			
								Hastighetsmätare	Tachometer			
6	1308757-2	1	1	1	1	1		Ledningsmatta extraljus	Kabelbaum Zusatzscheinwerfer		5	
								Fjärrstrålkastare	Weitstrahler			
	1308965	1	1	1	1	1	OP	Ledningsmatta extraljus	Kabelbaum Zusatzscheinwerfer	(S)		
								Dimstrålkastare	Nebelscheinwerfer			
7	1308255-7	1	1	1	1	1		Ledningsmatta elektrisk	Kabelbaum elektrischer	P.W , A.C	5	
								fönsterhiss	Fensterheber			
								Kylarfläkt	Lufter			
8	1308756-4	1	1	1	1	1		Ledningsmatta	Kabelbaum		5	
								Taklucka	Schiebedach			
9	1323031-3	1	1	1	1	1		Ledningsmatta	Kabelbaum		5	
								Antenn	Antenne			
10	1324874-5	1	1	1	1	1		Ledningsmatta intervallräknare	Kabelbaum Intervallzähler		3	
								LAMBDA SOND	LAMBDA SOND			

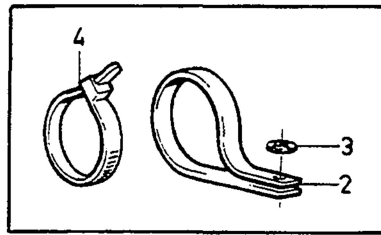

VOLVO PARTS
1 030 33467
(104:3)

A		B19E,ET					LEDNINGSMATTA INSTRUMENTBRÄDA		KABELBAUM, KABELKANAL ARMATURENBRETT		Grupp	
B		B23E,ET,FT									Gruppe	
C		B28A,E,F									37	
D		DSL									Sida	
E											Seite	
							1984-		539			
Pos	Artikelnummer Artikelnr.	Antal / Anzahl					P S	Benämning	Bezeichnung	Anmärkning Anmerkung	S R	
		A	B	C	D	E						
1	1324292-0	1	1	-	-	-	OP	Ledningsmatta	Kabelbaum	L.H.D B19E, B23E	5	
	1324294-6	1	1	-	-	-		Instrumentbräda	Armaturenbrett	R.H.D B19E, B23E	5	
	1324293-8	1	-	-	-	-		Ledningsmatta	Kabelbaum	L.H.D B19ET	5	
	1347610-6	-	1	-	-	-		Instrumentbräda	Armaturenbrett	L.H.D B23ET	5	
	1347782-3	-	1	-	-	-		Ledningsmatta	Kabelbaum	APP. CH-47999	5	
	1324303-5	-	1	-	-	-		Instrumentbräda	Armaturenbrett	L.H.D B23ET	5	
	1347783-1	-	1	-	-	-		Ledningsmatta	Kabelbaum	APP CH 48000-	5	
	1324971-9	-	1	-	-	-		Instrumentbräda	Armaturenbrett	R.H.D B23ET	5	
	1348300-3	-	1	-	-	-		Ledningsmatta	Kabelbaum	APP CH 48000-	5	
	1347898-7	-	1	-	-	-		Instrumentbräda	Armaturenbrett	L.H.D B23FT	5	
	1324643-4	-	-	1	-	-		Ledningsmatta	Kabelbaum	AUTO.TRANS AW71	5	
	1324644-2	-	-	1	-	-		Instrumentbräda	Armaturenbrett	L.H.D B23FT	5	
	1324721-8	-	-	1	-	-		Ledningsmatta	Kabelbaum	MAN.TRANS M46	5	
	1324291-2	-	-	1	-	-		Instrumentbräda	Armaturenbrett	R.H.D B23FT	5	
	1324298-7	-	-	1	-	-		Ledningsmatta	Kabelbaum		5	
	1324297	-	-	-	1	-		Instrumentbräda	Armaturenbrett		5	
	1347581-9	-	-	-	1	-		Ledningsmatta	Kabelbaum		5	
	1324296-1	-	-	-	1	-		Instrumentbräda	Armaturenbrett		5	
1a		1	1	1	1	-		Ledningsmatta	Kabelbaum		5	
2	3523130-7	X	X	X	X	-		Instrumentbräda	Armaturenbrett		5	
3	191695-6	X	X	X	X	-		Ledningsmatta	Kabelbaum		5	
4	948211-8	X	X	X	X	-		Instrumentbräda	Armaturenbrett		5	
5	3515928-4	1	1	1	1	-		Ledningsmatta	Kabelbaum		5	
		1	1	1	1	-		Givare	Geber		5	
		1	1	1	1	-		Hastighetsmätare	Tachometer		5	
		1	1	1	1	-	Ledningsmatta	Kabelbaum	ABS	5		
6	1308757-2	1	1	1	1	-	Ledningsmatta extraljus	Kabelbaum Zusatzscheinwerfer	SEE 37-545	5		
	1347595-9	1	1	1	1	-	Fjärrstrålkastare	Weitstrahler		5		
7	1308255-7	1	1	1	1	-	Ledningsmatta extraljus	Kabelbaum Zusatzscheinwerfer		5		
		1	1	1	1	-	Dimstrålkastare	Nebelscheinwerfer		5		
		1	1	1	1	-	Ledningsmatta elektrisk	Kabelbaum elektrischer	P.W , A.C	5		
		1	1	1	1	-	fönsterhiss	Fensterheber		5		
		1	1	1	1	-	Kylarfläkt	Lufter		5		
8	1308756-4	1	1	1	1	-	Ledningsmatta	Kabelbaum		5		
		1	1	1	1	-	Taklucka	Schiebedach		5		
9	1323031-3	1	1	1	1	-	Ledningsmatta	Kabelbaum		5		
		1	1	1	1	-	Antenn	Antenne		5		
10	1324874-5	1	1	1	1	-	Ledningsmatta intervallräknare	Kabelbaum Intervallzähler	(USA)	3		
		1	1	1	1	-	LAMBDA SOND	LAMBDA SOND		3		