


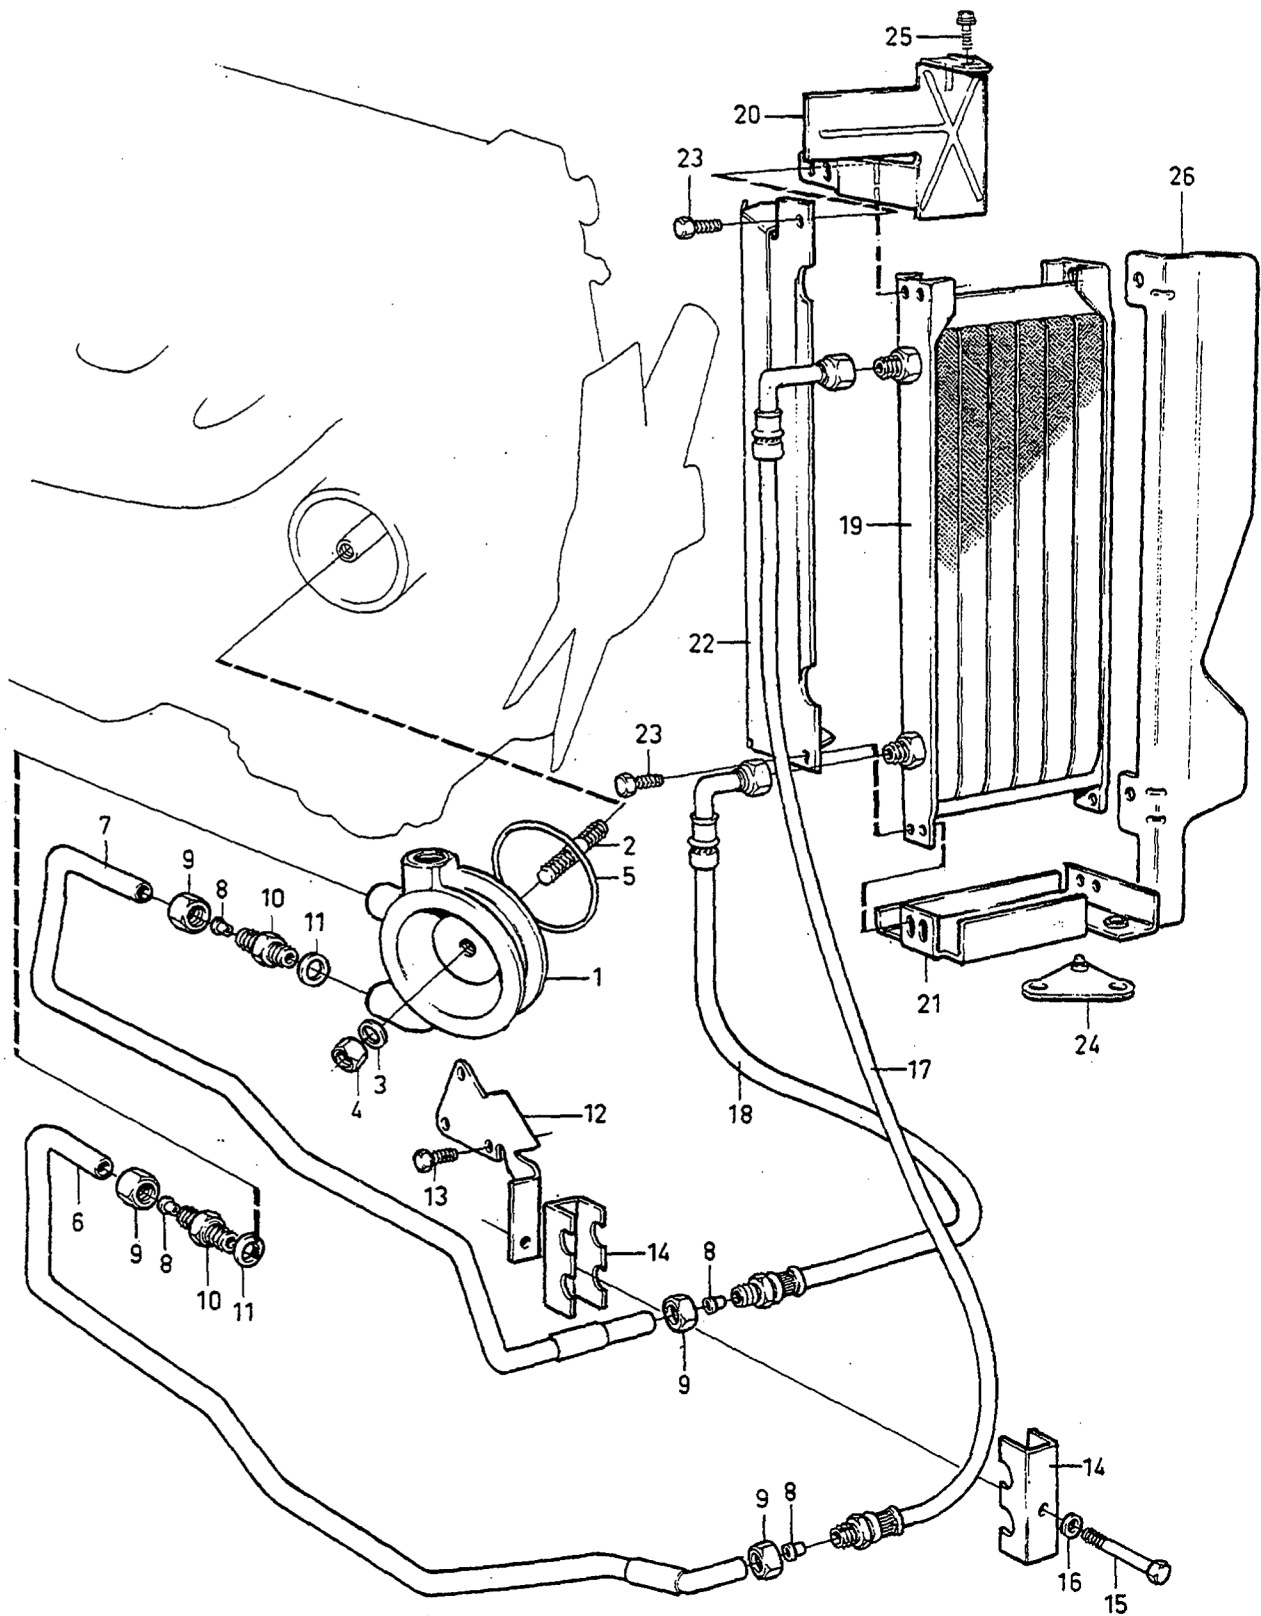

VOLVO PARTS
 1-021 34606
 (101:6)

A	B19ET					OLJEKYLNING		ÖLKÜHLUNG		Grupp Gruppe	
B	B23ET,B23FT									22	
C										Sida Seite	
D										195	
E								B19,B23 TURBO			
Pos	Artikelnummer Artikelnr.	Antal / Anzahl					P S	Benämning	Bezeichnung	Anmärkning Anmerkung	S R
		A	B	C	D	E					
1	1276680-4	1	1	-	-	-		Termostathus	Thermostatgehäuse		3
2		-	-	-	-	-		Nippel	Nippel		
		1	-	-	-	-		• SEE 22 • 193/A	• SEE 22 • 193/A		
		-	1	-	-	-		• B23ET	• B23ET		
		-	1	-	-	-		• • SEE 22 • 193/B	• • SEE 22 • 193/B		
		-	1	-	-	-		• B23FT	• B23FT		
		-	1	-	-	-		• • SEE 22 • 193/C	• • SEE 22 • 193/C		
3	824589-6	1	1	-	-	-		Bricka	Scheibe		3
4	191701-2	1	1	-	-	-		Mutter	Mutter		2
5	925093-7	1	1	-	-	-	IK	O-ring	O-ring		2
6	1332574-1	1	1	-	-	-		Oljerör	Ölrohr		3
7	1332572-5	1	1	-	-	-		Oljerör	Ölrohr		3
8	956970-8	4	4	-	-	-		• Skärring	• Schneidring		2
9	956984-9	4	4	-	-	-		• Mutter	• Mutter		2
10	969155-1	2	2	-	-	-		Nippel	Nippel	(945629)	2
11	957179-5	2	2	-	-	-	IK	Packning	Dichtung		2
12	1306152	1	1	-	-	-	OP	Konsol	Konsole		4
13		3	3	-	-	-		Skruv	Schraube		
								• SEE 64 • 881	• SEE 64 • 881		
14	1306156	2	2	-	-	-	OP	Klamma	Klemme		3
15	940101-9	1	1	-	-	-		Skruv	Schraube	M6x40	2
16	960139-4	1	1	-	-	-		Bricka	Scheibe		2
17	1336836-0	1	1	-	-	-		Oljeslang	Ölschlauch	(1306258)	2
18	1336835-2	1	1	-	-	-		Oljeslang	Ölschlauch	(1306257)	2
19	1276676-2	1	1	-	-	-		Oljekylare	Ölkuhler		5
20	3514143-1	1	1	-	-	-		Konsol övre	Konsole oben	(1378431)	4
21	1378430-1	1	1	-	-	-		Konsol undre	Konsole untere		4
22	1317912	1	-	-	-	-	OP	Täckplåt	Abdeckblech		4
	1378432-7	-	1	-	-	-		Täckplåt	Abdeckblech		4
23	946544-4	8	8	-	-	-		Flänsskruv	Flanschschraube	M6x16	2
24		1	1	-	-	-	NS	Gummikudde	Gummikissen		
25	965175-3	1	1	-	-	-		Flänsskruv	Flanschschraube	M6x12	2
26	1378433-5	1	1	-	-	-		Luftskärm	Luftschirm		4