


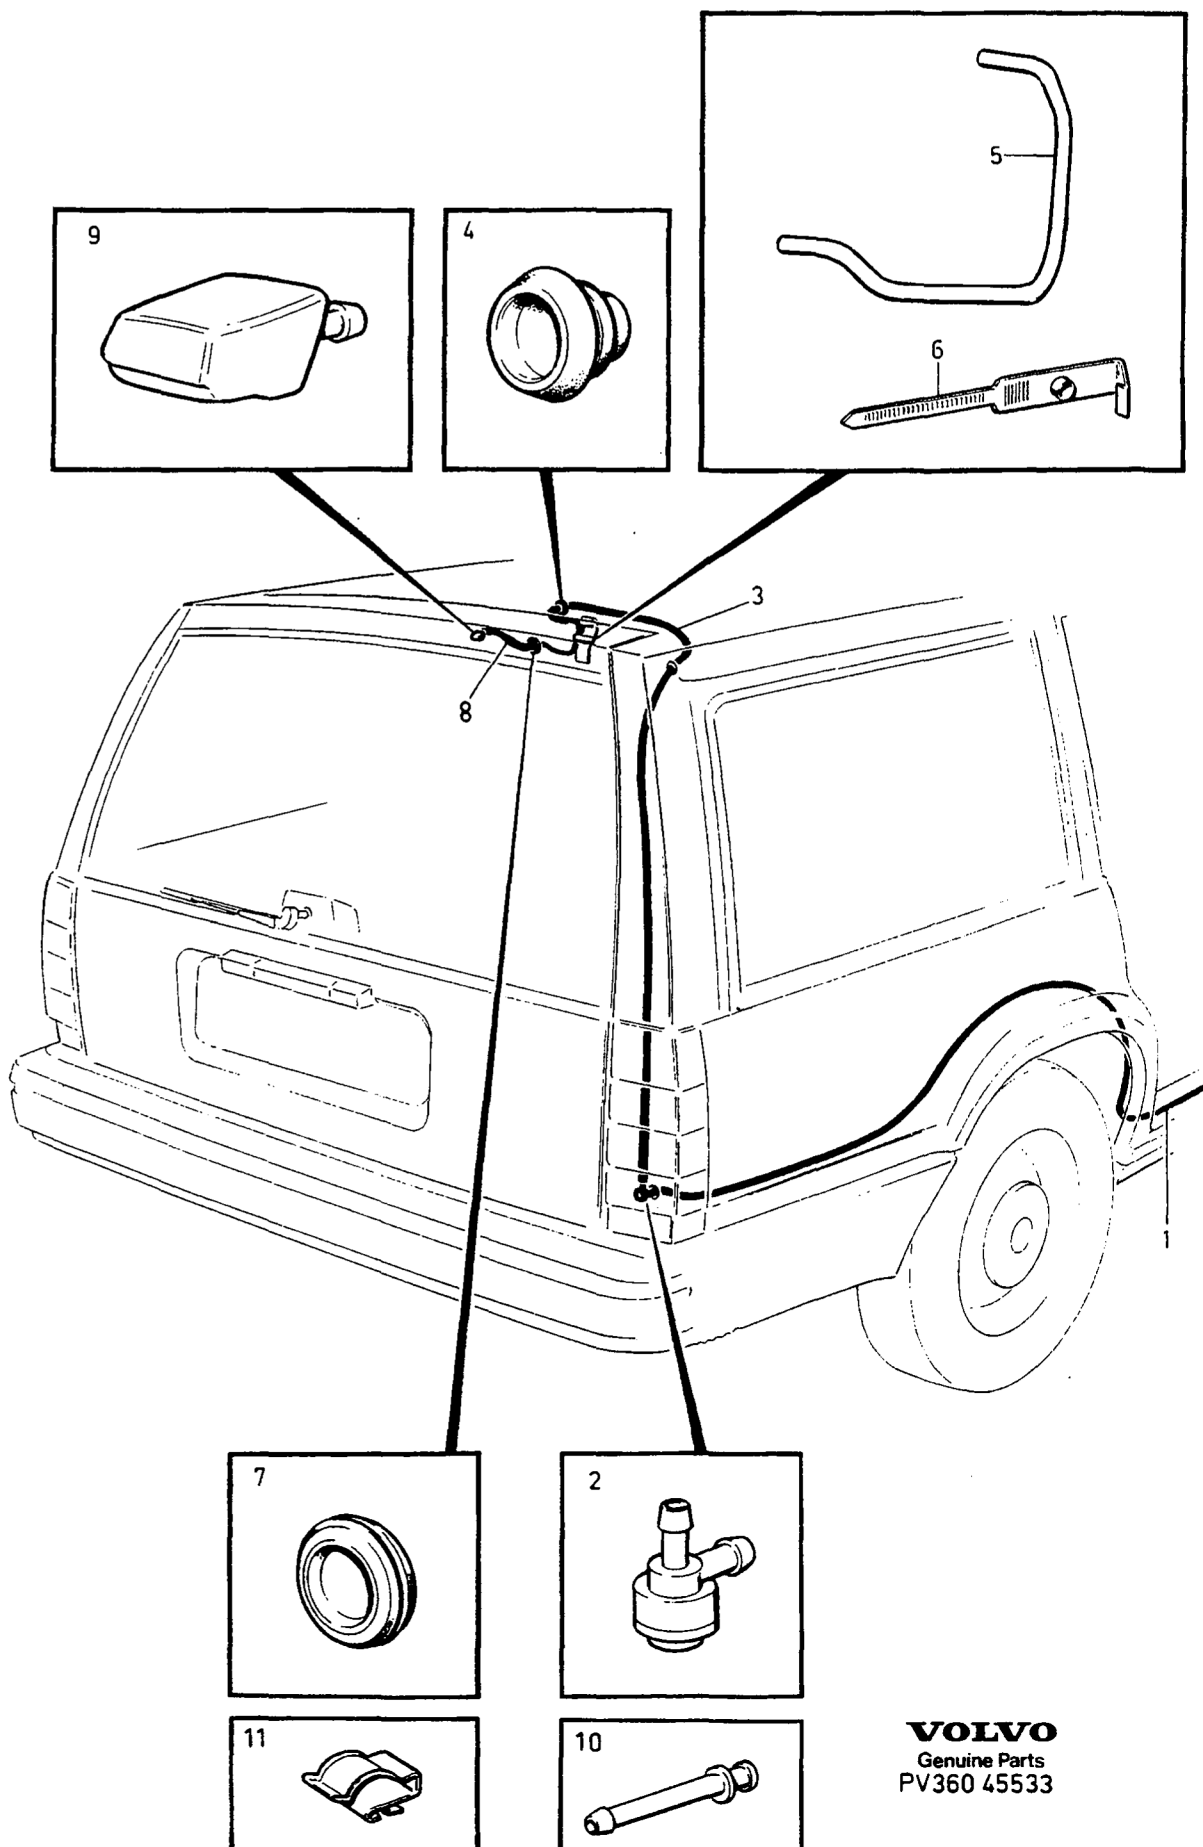

VOLVO
Genuine Parts
PV360 45533

A							REAR WINDOW WASHER		BAKRUTESPOLARE		Group Grupp	
B											36	
C											Page Sida	
D											619	
E												
Fig	Part No. Artikel nr	Quantity / Antal					P S	Description	Benämning	Notes Anmärkning	S R	
		A	B	C	D	E						
		1	-	-	-	-		Water reservoir	Vattenbehållare	SEE 36 • 615		
		1	-	-	-	-		Pump	Pump	SEE 36 • 615		
1	949931-0	X	-	-	-	-		Rubber hose by the meter	Gummislang metervara	LG 5100mm	2	
2	1304460-7	1	-	-	-	-		Delivery valve	Tryckventil		2	
3	949931-0	X	-	-	-	-		Rubber hose by the meter	Gummislang metervara	LG 1250mm	2	
4	1258069-2	1	-	-	-	-		Grommet	Genomföring		3	
5	1369535-8	1	-	-	-	-		Pipe elbow	Rörkrök		3	
6	1347588-4	1	-	-	-	-		Strip clamp	Bandklamma		3	
7	941268-5	1	-	-	-	-		Protecting plug	Skyddsplugg		2	
8	949931-0	X	-	-	-	-		Rubber hose by the meter	Gummislang metervara	LG 130mm	2	
9	1369855-0	1	-	-	-	-		Washer jet	Spolarmunstycke		2	
10	1304944-0	1	-	-	-	-		Connector	Skarvstycke		3	
11	1304859-0	1	-	-	-	-		Retaining clip	Hållare		2	