


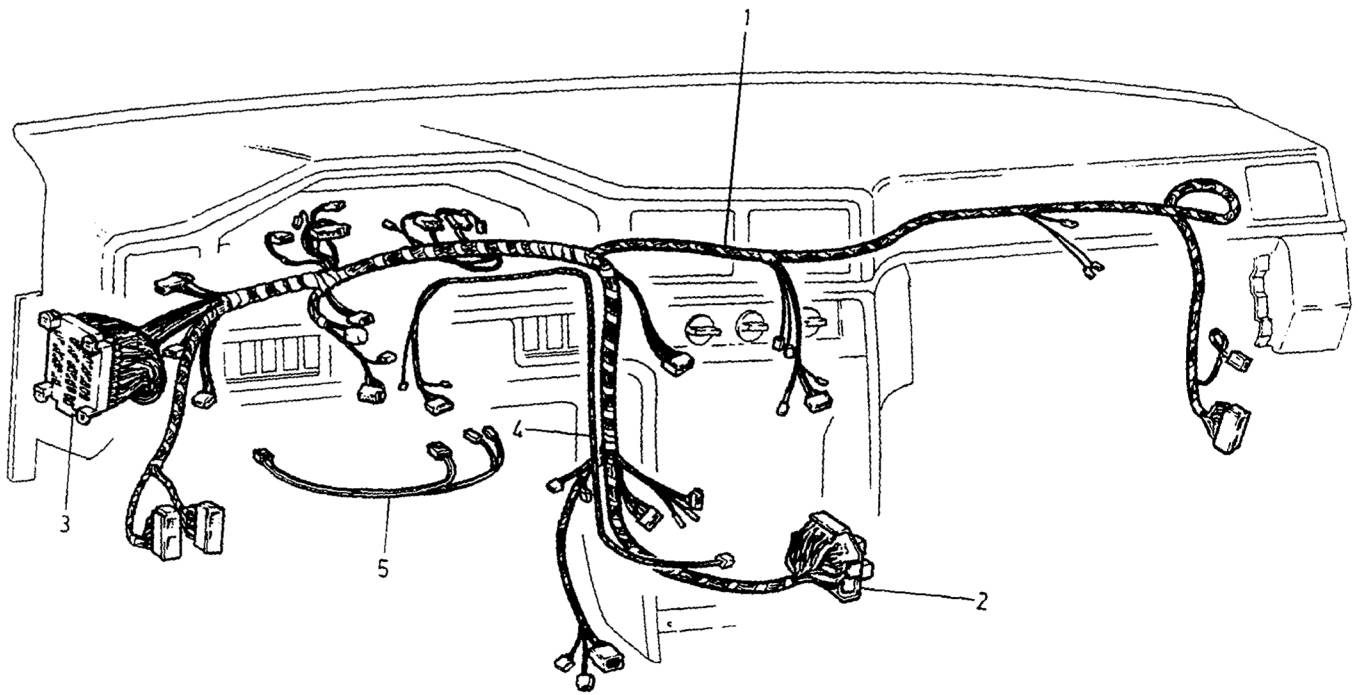

VOLVO
Genuine Parts
PV 370 49526

A						CABLE HARNESS DASHBOARD		LEDNINGSMATTA INSTRUMENTBRÄDA		Group Grupp	
B										37	
C										Page Sida	
D										471	
E											
Fig	Part No. Artikel nr	Quantity / Antal					P S	Description	Benämning	Notes Anmärkning	S R
		A	B	C	D	E					
1	1362927-4	1	-	-	-	-		Cable harness	Ledningsmatta	1) B230ET, L.H.D	5
								Dashboard	Instrumentbräda		
	1398976-9	1	-	-	-	-		Cable harness	Ledningsmatta	2) -1989 B230ET, L.H.D	5
								Dashboard	Instrumentbräda		
	1362928-2	1	-	-	-	-		Cable harness	Ledningsmatta	1) B230ET, R.H.D	5
								Dashboard	Instrumentbräda		
	3523517-5	1	-	-	-	-		Cable harness	Ledningsmatta	-1989 B230ET, R.H.D	5
								Dashboard	Instrumentbräda		
	1398982-7	1	-	-	-	-		Cable harness	Ledningsmatta	2) -1989	5
								Dashboard	Instrumentbräda	B230FT L.H.D EXC (N)	
	1398539-5	1	-	-	-	-		Cable harness	Ledningsmatta	1990 B230FT/GT	5
								Dashboard	Instrumentbräda	L.H.D EXC (N)	
	3515845-0	1	-	-	-	-		Cable harness	Ledningsmatta	B230FT, (N).	5
								Dashboard	Instrumentbräda		
	3515630-6	1	-	-	-	-		Cable harness	Ledningsmatta	1990 B230FT/GT	5
								Dashboard	Instrumentbräda	R.H.D	
	1363918-2	1	-	-	-	-		Cable harness	Ledningsmatta	1) B280, L.H.D	5
								Dashboard	Instrumentbräda		
	1398981-9	1	-	-	-	-		Cable harness	Ledningsmatta	2) -1989	5
								Dashboard	Instrumentbräda	B280, L.H.D	
	1398530-4	1	-	-	-	-		Cable harness	Ledningsmatta	3)	5
								Dashboard	Instrumentbräda	1990 B280 L.H.D	
	3523690-0	1	-	-	-	-		Cable harness	Ledningsmatta	4)	5
								Dashboard	Instrumentbräda	1990 B280 L.H.D	
	1362926-6	1	-	-	-	-		Cable harness	Ledningsmatta	1) B280, R.H.D	5
								Dashboard	Instrumentbräda		
	3523516-7	1	-	-	-	-		Cable harness	Ledningsmatta	-1989 B280, R.H.D	5
								Dashboard	Instrumentbräda		
	1398538-7	1	-	-	-	-		Cable harness	Ledningsmatta	1990 B280 R.H.D	5
								Dashboard	Instrumentbräda		
	1362931-6	1	-	-	-	-		Cable harness	Ledningsmatta	1)	5
								Dashboard	Instrumentbräda	D24TIC L.H.D	
	1398979-3	1	-	-	-	-		Cable harness	Ledningsmatta	2)	5
								Dashboard	Instrumentbräda	-1989 D24TIC L.H.D	
	1398514-8	1	-	-	-	-		Cable harness	Ledningsmatta	1990	5
								Dashboard	Instrumentbräda	D24TIC, L.H.D	
	1362932-4	1	-	-	-	-		Cable harness	Ledningsmatta	1)	5
								Dashboard	Instrumentbräda	D24TIC R.H.D	
	3523519-1	1	-	-	-	-		Cable harness	Ledningsmatta	-1989 D24TIC, R.H.D	5
								Dashboard	Instrumentbräda		
	1398523-9	1	-	-	-	-		Cable harness	Ledningsmatta	1990 D24TIC R.H.D	5
								Dashboard	Instrumentbräda		
2		1	-	-	-	-		Relay panel	Reläpanel	SEE 37-509	
3		1	-	-	-	-		Fuse box	Säkringsdosa	SEE 37-509	
4	3515999-5	1	-	-	-	-		Cable harness	Ledningsmatta	(1363732) 5DRS	5
								Rear window wiper	Bakrutetorkare		
	3523514-2	1	-	-	-	-		Cable harness foglamp	Ledningsmatta dimljus	R.H.D	5
	1362951-4	1	-	-	-	-		Cable harness	Ledningsmatta		5
								Heating and ventilation	Klimatanläggning		
	1362937-3	1	-	-	-	-		Cable harness	Ledningsmatta	R.H.D (J)	5
								cruise control	konstantfartållare		
	9130000-4	1	-	-	-	-		Ignition cable	Tändledning	(J)	5
								" AIRBAG "	" AIRBAG "		
5	1362930-8	1	-	-	-	-		Cable harness	Ledningsmatta		3
								Pedal arrangement	Pedalställ		

1) 760 4DRS CH -58499. 760 5DRS CH -23499.

2) 760 4DRS CH 58500-. 760 5DRS CH 23500-.

3) Without cruise control. / Utan konstantfartållare.

4) With cruise control. / Med konstantfartållare.