


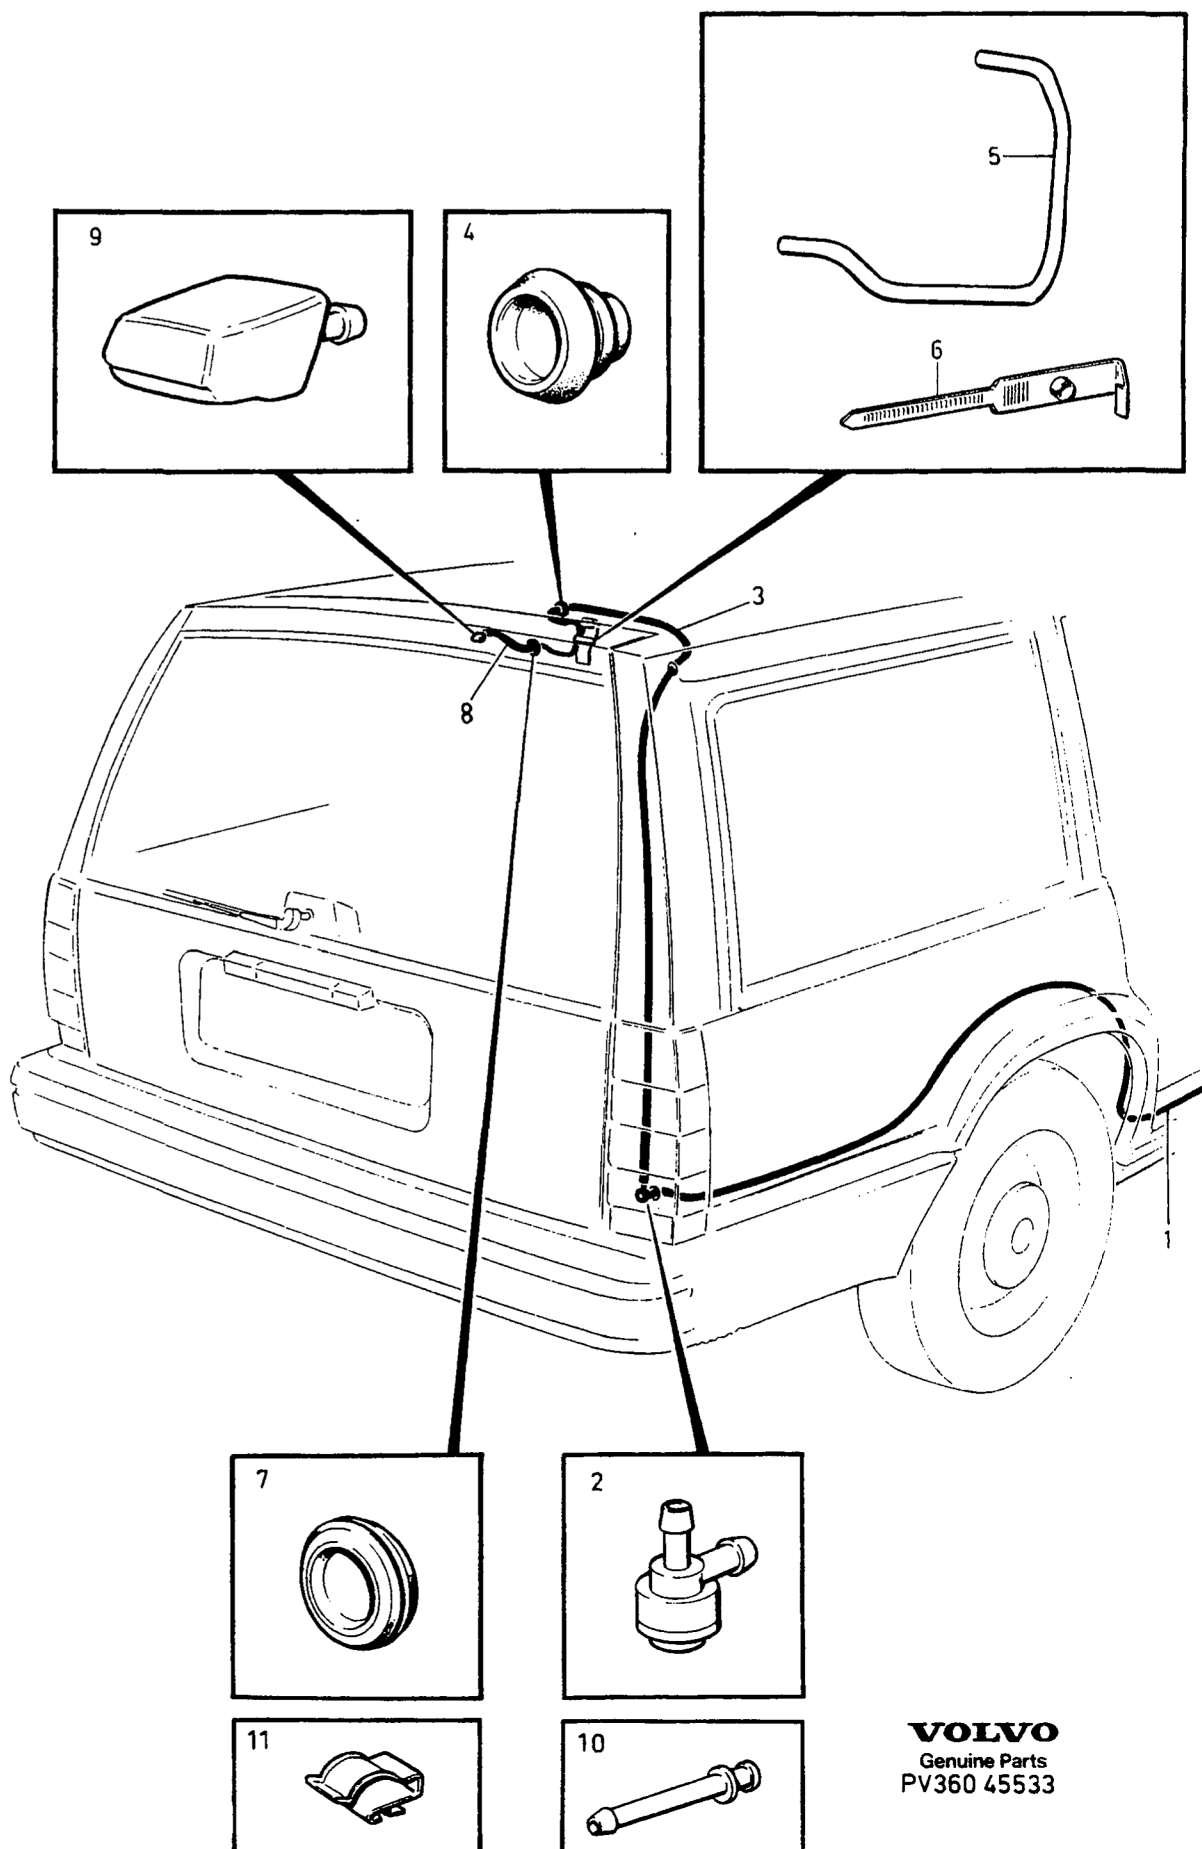

VOLVO
Genuine Parts
PV360 45533

A						REAR WINDOW WASHER		BAKRUTESPOLARE		Group Grupp	
B											
C											
D											
E											
Fig	Part No. Artikel nr	Quantity / Antal					P S	Description	Benämning	Notes Anmärkning	S R
		A	B	C	D	E					
1	949931-0	1	-	-	-	-		Water reservoir	Vattenbehållare	SEE 36-447	2
		1	-	-	-	-		Pump	Pump	SEE 36-447	
2	1304460-7	X	-	-	-	-		Rubber hose	Gummislang	L.H.D , LG 5400mm	2
		X	-	-	-	-		Rubber hose	Gummislang	R.H.D , LG 5100mm	
3	949931-0	X	-	-	-	-		Delivery valve	Tryckventil		2
4	1258069-2	1	-	-	-	-		Rubber hose	Gummislang	LG 1250mm	2
5	1369535-8	1	-	-	-	-		Grommet	Genomföring		3
6	1347588-4	1	-	-	-	-		Pipe elbow	Rörkrök		3
7	941268-5	1	-	-	-	-		Strip clamp	Bandklamma		3
8	949931-0	X	-	-	-	-		Protecting plug	Skyddsplugg		2
9	1369855-0	1	-	-	-	-		Rubber hose	Gummislang	LG 130mm	2
10	1304944-0	1	-	-	-	-		Washer jet	Spolarmunstycke		2
11	1304859-0	1	-	-	-	-		Connector	Skarvstycke		3
		1	-	-	-	-		Retaining clip	Hållare		