


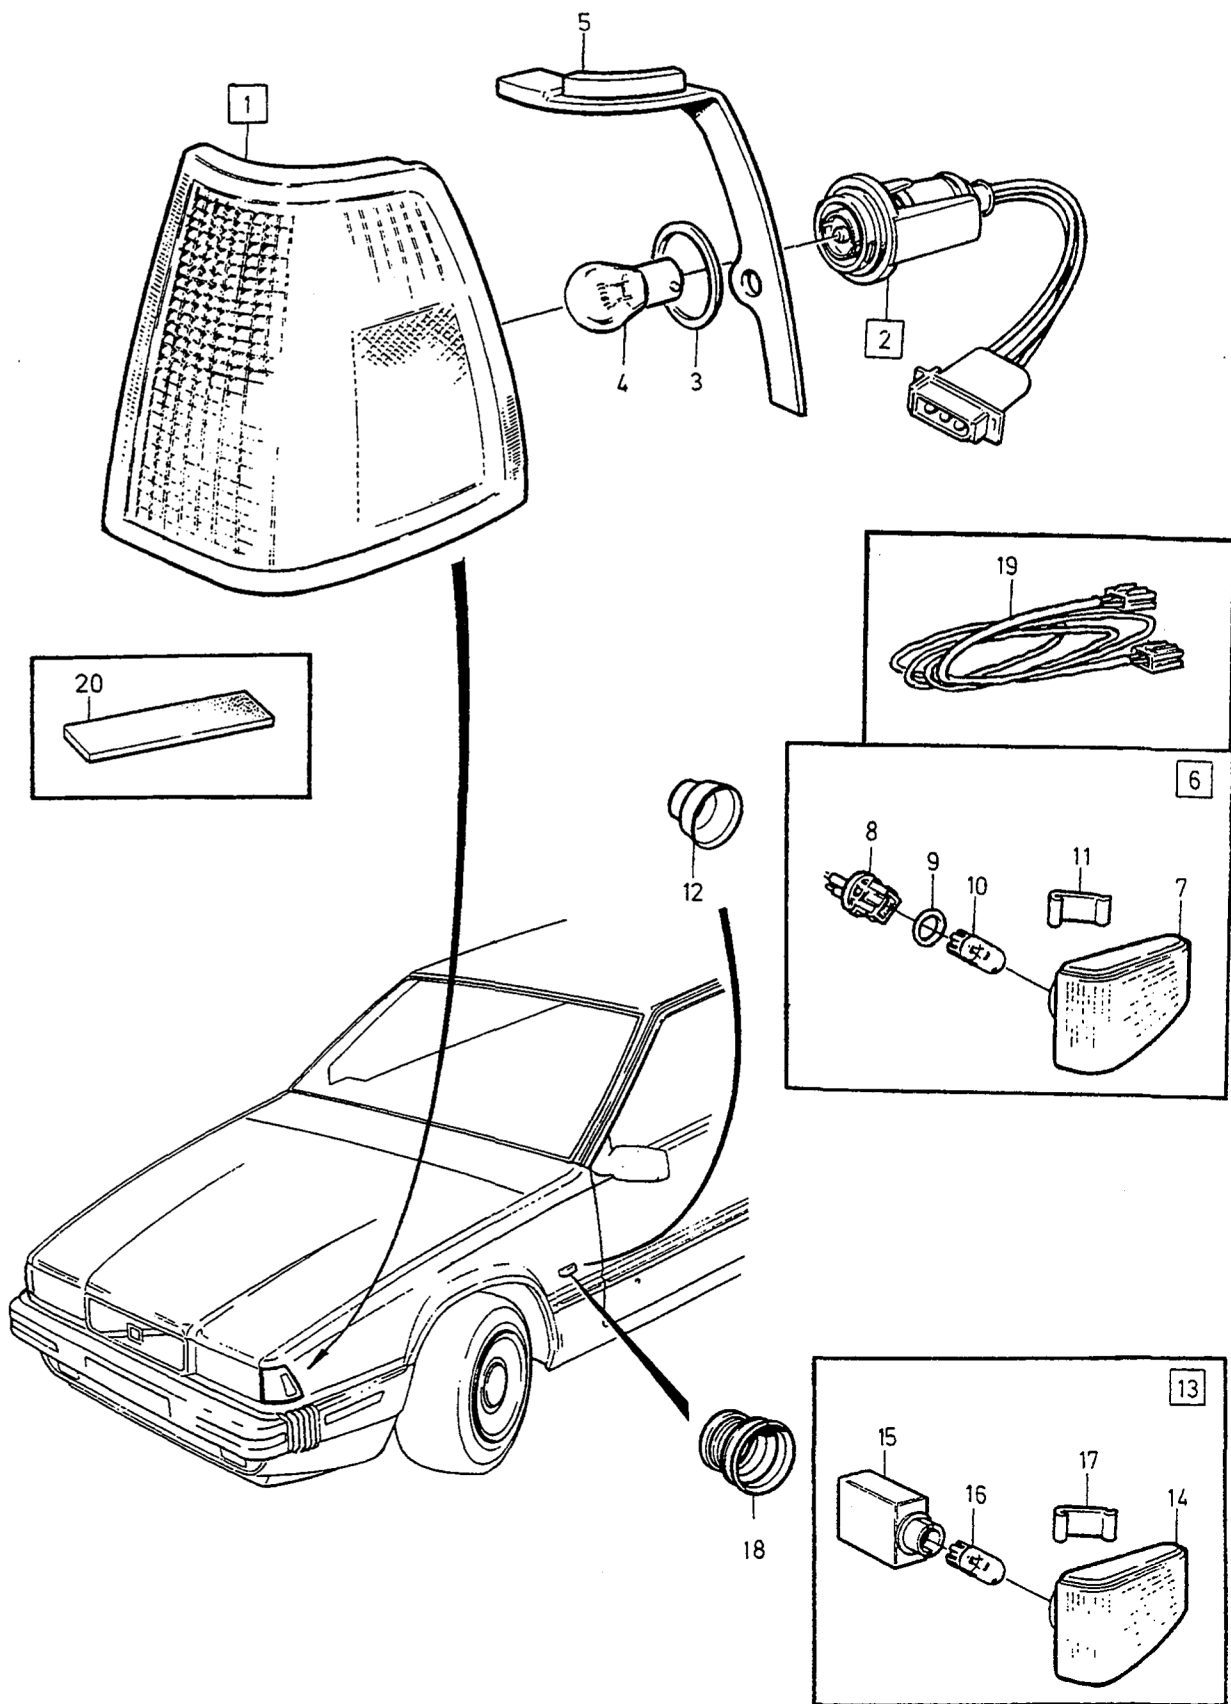

VOLVO
Genuine Parts
PV 350 51607

A						TURN INDICATORS		BLINKERS		Group Grupp	
B										35	
C										Page Sida	
D										431	
E						1)					
Fig	Part No. Artikel nr	Quantity / Antal					P S	Description	Benämning	Notes Anmärkning	S R
		A	B	C	D	E					
1	(1341320)	1	-	-	-	-	SP	Direction indicator, l.h. complete	Blinklykta, v komplett	REPL 1PCS 1374606-0, 1PCS 3406419-6.	2
	1374606-0	-	-	-	-	-		Direction indicator, l.h.	Blinklykta, v komplett	SEE 35 • 433	2
	(1341321)	1	-	-	-	-	SP	Direction indicator, r.h. complete	Blinklykta, h komplett	REPL 1PCS 1374607-8, 1PCS 3406419-6.	2
	1374607-8	-	-	-	-	-		Direction indicator, r.h.	Blinklykta, h komplett	SEE 35 • 433	2
2	1376439-4	1	-	-	-	-		• Bulb socket with cable	• Lamphållare med kabel		2
3	1376440-2	1	-	-	-	-		• Seal	• Tätning		2
4	965826-1	1	-	-	-	-		• Bulb	• Glödlampa	21W	1
5	1341498-2	1	-	-	-	-		Seal, l.h.	Tätning, v		2
	1341499-0	1	-	-	-	-		Seal, r.h.	Tätning, h		2
6	1312839-2	2	-	-	-	-		Direction indicator complete ...	Blinklykta komplett	-1987	2
7		1	-	-	-	-	NS	• Lamp body	• Lamphus		
8		1	-	-	-	-	NS	• Bulb socket	• Lamphållare		
9	1369304-9	1	-	-	-	-		• Seal	• Tätning		3
10	949671-2	1	-	-	-	-		• Bulb	• Glödlampa	5W	1
11	1372321-8	1	-	-	-	-		• Spring	• Fjäder		3
12	686355-9	2	-	-	-	-		Rubber bushing	Gummibussning	-1987	5
13	1372255-8	2	-	-	-	-		Direction indicator complete ...	Blinklykta komplett	1988-	2
14		1	-	-	-	-	NS	• Lamp body	• Lamphus		
15	1392580	1	-	-	-	-	OP	• Bulb socket	• Lamphållare		3
16	949671-2	1	-	-	-	-		• Bulb	• Glödlampa	5W	1
17	1372321-8	1	-	-	-	-		• Spring	• Fjäder		3
18	3518007-4	2	-	-	-	-		Rubber bushing	Gummibussning	1988-	4
19	3406419-6	1	-	-	-	-		Cable harness	Ledningsmatta		5
20	3510476-9	2	-	-	-	-		Seal	Tätning	LG 160x10x3 mm CH 5034-	3

1) CH -6499.